



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: DEL_MAR_AVE Cross Street: SANTA_ANA_AVE Location: N

ADA ID: RPAT220128161740 Ramp Type: Type 1 - Perpendicular Diagonal Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 26

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

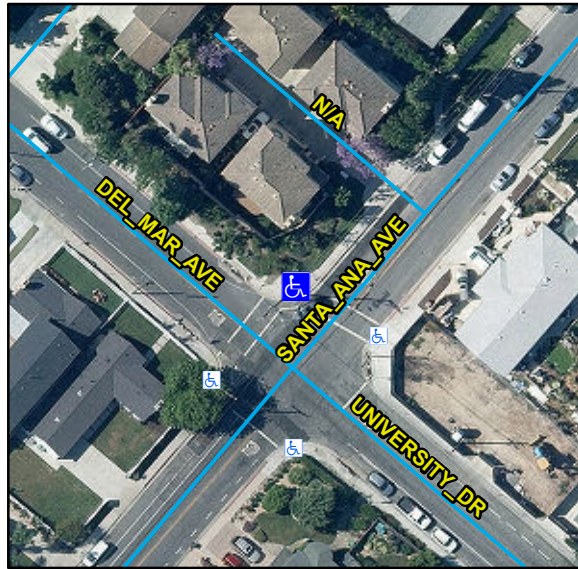

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter. Utility Present.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R305, R302.7.2, R304.5.4, STD 1115

Total Cost: \$ 6412

Parcel ID Number 439-204-07
Ramp Island Or Median None
Ramp Orientation Diag
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.65831969,-117.89040311

Street 1 Name DEL_MAR_AVE
Stop Condition-Street 1 StopSign
Street 2 Name SANTA_ANA_AVE
Stop Condition-Street 2 StopSign

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	Yes
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A		Power Pole	

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	71	N/A	Flare Type LT	
Yes	Ramp Width (in)	64			Sloped
Yes	Ramp Run Slope (%)	6.9	Yes	Flare Slope LT (%)	2.1
Yes	Ramp Cross Slope (%)	1.6	N/A	Flare Traversable LT	Yes
N/A	Landing Present	Yes	Yes	Flare Type RT	
N/A	Landing Length (in)	66			Curbed2
Yes	Landing Width (in)	61	N/A	Flare Slope RT (%)	N/A
No	Landing Run Slope (%)	4.1	N/A	Flare Traversable RT	N/A
No	Landing Cross Slope (%)	2.3	No	DWS Provided	No
N/A	Landing Movement Obstructed?	No	N/A	DWS Contrast	N/A
	Landing Movement Type	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Shared	Yes	N/A	DWS Full Width	N/A
Yes	Clear Space	Yes	N/A	DWS Offset Left (in)	N/A
Yes	Clear Space To Crosswalk (in)	48	N/A	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	Yes
	Crossing 1 Direction	SE		Crossing 2 Direction	SW
	Marked Crosswalk 1 Width (in)	133		Marked Crosswalk 2 Width (in)	133
Yes	Ramp Inside Crosswalk 1	Yes	Yes	Ramp Inside Crosswalk 2	Yes
	Crossing 1 Slope (%)	3.6		Crossing 2 Slope (%)	3.8
	Crossing 1 Cross Slope (%)	1.3		Crossing 2 Cross Slope (%)	0.6
Yes	Gutter Ponding	No	No	Curb Slope	7.7
No	Gutter Lip Height (in)	1.5		Road Run Slope (%)	0.8
No	Gutter Run Slope (%)	6.6		Road Cross Slope (%)	1.8
Yes	Gutter Cross Slope (%)	1.7			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

