



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: SANTO_TOMAS_ST Cross Street: SANTA_ANA_AVE Location: W

ADA ID: RPAT220128164805 Ramp Type: Type 4 - Parallel Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 34

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

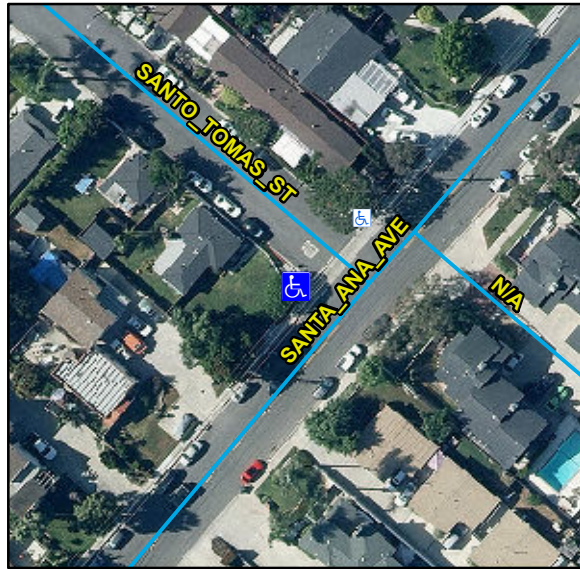

Possible Solutions:

Remove & Replace Entire Ramp. Remove & Replace Gutter. Replace Spandrel.

Surveyor Notes:

N/A

OC Std/PROW:

R302.7, STD 122-2, R305, R302.7.2, R304.5.4, R304.5.3, STD 1115

Total Cost: \$ 5202

Parcel ID Number 439-201-34
Ramp Island Or Median None
Ramp Orientation NonDiag
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.65993027,-117.88881768

Street 1 Name SANTO_TOMAS_ST
Stop Condition-Street 1 StopSign
Street 2 Name SANTA_ANA_AVE
Stop Condition-Street 2 N/A

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	110	N/A	Ramp Length RT (in)	110
Yes	Ramp Width LT (in)	49	Yes	Ramp Width RT (in)	49
Yes	Ramp Run Slope LT (%)	4.7	Yes	Ramp Run Slope RT (%)	8
Yes	Ramp Cross Slope LT (%)	0.1	Yes	Ramp Cross Slope RT (%)	0.1
N/A	Landing Present	Yes	No	DWS Provided	No
N/A	Landing Length (in)	49	N/A	DWS Contrast	N/A
Yes	Landing Width (in)	60	N/A	DWS Length (in)	N/A
Yes	Landing Run Slope (%)	0	N/A	DWS Full Width	N/A
Yes	Landing Cross Slope (%)	0.3		DWS Offset Type	N/A
N/A	Landing Movement Obstructed?	No	N/A	DWS Offset Left (in)	N/A
	Landing Movement Type	Curb	N/A	DWS Offset Right (in)	N/A
N/A	Landing Shared	No			
N/A	Clear Space	N/A			
N/A	Clear Space To Crosswalk (in)	N/A			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	N/A
	Crossing 1 Direction	NE		Crossing 2 Direction	N/A
N/A	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	0.6		Crossing 2 Slope (%)	N/A
	Crossing 1 Cross Slope (%)	2.3		Crossing 2 Cross Slope (%)	N/A
Yes	Gutter Ponding	No	Yes	Curb Slope	2.4
No	Gutter Lip Height (in)	0.5		Road Run Slope (%)	N/A
No	Gutter Run Slope (%)	13.4		Road Cross Slope (%)	N/A
No	Gutter Cross Slope (%)	2.4	Yes	Perpendicular Joint Present	Yes
No	Overall Surface Condition	Poor			
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	Yes

