



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: SANTA_ANA_AVE Cross Street: MESA_DR Location: SE

ADA ID: RPAT220128174225 Ramp Type: Type 1 - Perpendicular Diagonal Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 0

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

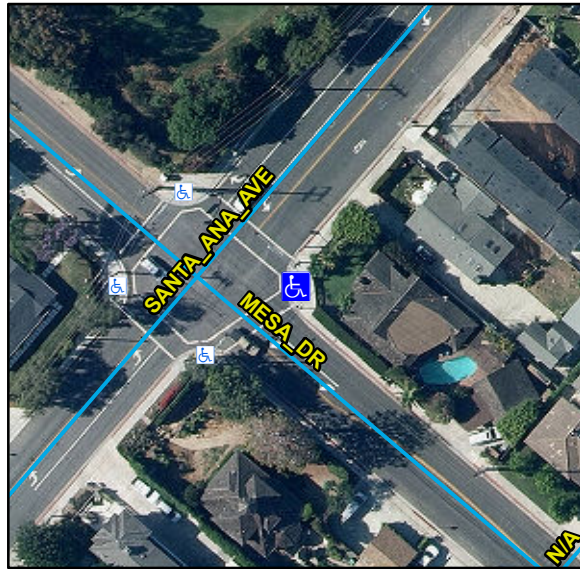

Possible Solutions:

Remove & Replace Curb Slope. Utility Present.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, STD 1115

Total Cost: \$ 252

Parcel ID Number	439-241-01	Street 1 Name	SANTA_ANA_AVE
Ramp Island Or Median	None	Stop Condition-Street 1	Signal
Ramp Orientation	Diag	Street 2 Name	MESA_DR
Google Street View Link:		Stop Condition-Street 2	Signal

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.66097979,-117.88746136

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	Yes
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A		Traffic Signal Pole	

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	83	N/A	Flare Type LT	
Yes	Ramp Width (in)	48		Sloped	
Yes	Ramp Run Slope (%)	7.3	Yes	Flare Slope LT (%)	5.9
Yes	Ramp Cross Slope (%)	0.3	N/A	Flare Traversable LT	Yes
N/A	Landing Present	Yes	N/A	Flare Type RT	
N/A	Landing Length (in)	61		Sloped	
Yes	Landing Width (in)	48	Yes	Flare Slope RT (%)	7.1
Yes	Landing Run Slope (%)	1.4	N/A	Flare Traversable RT	Yes
Yes	Landing Cross Slope (%)	0.4	Yes	DWS Provided	Yes
N/A	Landing Movement Obstructed?	Yes	Yes	DWS Contrast	Yes
	Landing Movement Type	Curb	Yes	DWS Length (in)	36
N/A	Landing Shared	Yes	Yes	DWS Full Width	Yes
Yes	Clear Space	Yes	Yes	DWS Offset Left (in)	2
Yes	Clear Space To Crosswalk (in)	48	Yes	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	Yes
	Crossing 1 Direction	NW		Crossing 2 Direction	W
	Marked Crosswalk 1 Width (in)	122		Marked Crosswalk 2 Width (in)	122
Yes	Ramp Inside Crosswalk 1	Yes	Yes	Ramp Inside Crosswalk 2	Yes
	Crossing 1 Slope (%)	7.7		Crossing 2 Slope (%)	5
	Crossing 1 Cross Slope (%)	0.3		Crossing 2 Cross Slope (%)	0.3
Yes	Gutter Ponding	No	No	Curb Slope	6.6
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	1.6
Yes	Gutter Run Slope (%)	3.2		Road Cross Slope (%)	5
Yes	Gutter Cross Slope (%)	0.8			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

