




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: CERRITOS_AVE Cross Street: BROOKHURST_ST Location: NW

ADA ID: RPAT220203134454 Ramp Type: Type 4 - Parallel Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 0

Codes/Mitigation Info/Possible Solution Field Measurements/Component Compliance

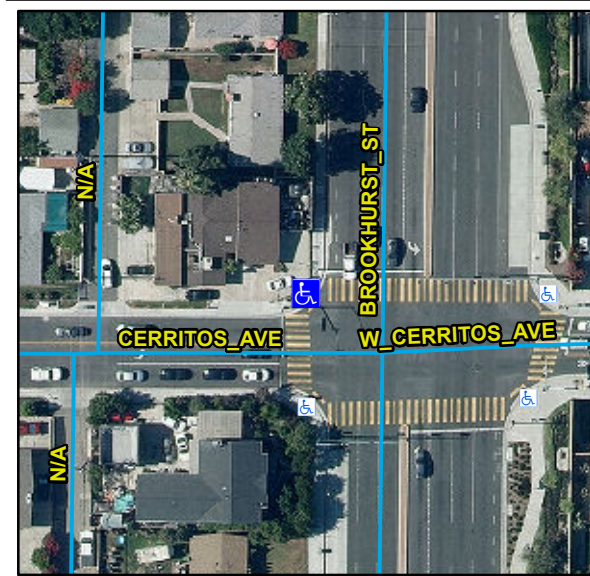

Possible Solutions:
Remove & Replace Curb Slope.

Surveyor Notes:
N/A

OC Std/PROW:
R304.2.2, STD 1115

Total Cost: \$ 252

Parcel ID Number **127-392-21**
Ramp Island Or Median **None**
Ramp Orientation **Diag**
Google Street View Link:
http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.81058901,-117.95904067

Street 1 Name **CERRITOS_AVE**
Stop Condition-Street 1 **Signal**
Street 2 Name **BROOKHURST_ST**
Stop Condition-Street 2 **Signal**

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A



Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	94	N/A	Ramp Length RT (in)	91
Yes	Ramp Width LT (in)	50	Yes	Ramp Width RT (in)	49
Yes	Ramp Run Slope LT (%)	5.3	Yes	Ramp Run Slope RT (%)	7
Yes	Ramp Cross Slope LT (%)	0.3	Yes	Ramp Cross Slope RT (%)	0.6
N/A	Landing Present	Yes	Yes	DWS Provided	Yes
N/A	Landing Length (in)	48	Yes	DWS Contrast	Yes
Yes	Landing Width (in)	48	Yes	DWS Length (in)	36
Yes	Landing Run Slope (%)	1.1	Yes	DWS Full Width	Yes
Yes	Landing Cross Slope (%)	0.2		DWS Offset Type	Single
N/A	Landing Movement Obstructed?	No	Yes	DWS Offset Left (in)	0
	Landing Movement Type	Curb	Yes	DWS Offset Right (in)	N/A
N/A	Landing Shared	No			
Yes	Clear Space	Yes			
Yes	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	Yes
	Crossing 1 Direction	S		Crossing 2 Direction	E
	Marked Crosswalk 1 Width (in)	158		Marked Crosswalk 2 Width (in)	151
Yes	Ramp Inside Crosswalk 1	Yes	Yes	Ramp Inside Crosswalk 2	Yes
	Crossing 1 Slope (%)	1.4		Crossing 2 Slope (%)	0.3
	Crossing 1 Cross Slope (%)	1.4		Crossing 2 Cross Slope (%)	1.3
Yes	Gutter Ponding	No	No	Curb Slope	10
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	1.3
Yes	Gutter Run Slope (%)	4		Road Cross Slope (%)	3.9
Yes	Gutter Cross Slope (%)	0.5	Yes	Perpendicular Joint Present	Yes
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A