




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: OSO_PKWY		Cross Street: N/A		Location: NE
ADA ID: RPAT220208112553	Ramp Type: Type 4 - Parallel	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 15

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance		
---	--	---	--	--

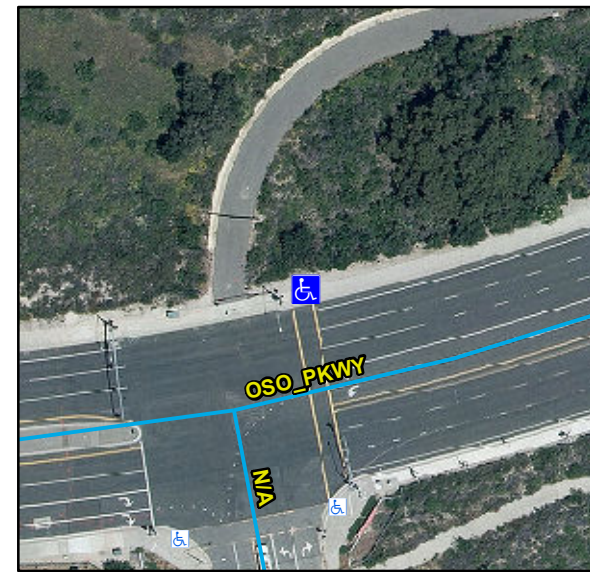

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

OC Std/PROW:

R304.3.2, STD 1115

Total Cost: \$ **2000**

Parcel ID Number	125-099-90	Street 1 Name	OSO_PKWY
Ramp Island Or Median	None	Stop Condition-Street 1	Signal
Ramp Orientation	NonDiag	Street 2 Name	N/A
Google Street View Link:		Stop Condition-Street 2	N/A

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.58614046,-117.61311623

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	Yes
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A		Pull Box	

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	107	N/A	Ramp Length RT (in)	100
Yes	Ramp Width LT (in)	82	Yes	Ramp Width RT (in)	82
No	Ramp Run Slope LT (%)	9.46	Yes	Ramp Run Slope RT (%)	5.3
Yes	Ramp Cross Slope LT (%)	0.1	Yes	Ramp Cross Slope RT (%)	1.12
N/A	Landing Present	N/A	N/A	DWS Provided	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Contrast	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	DWS Full Width	N/A
N/A	Landing Cross Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Offset Left (in)	N/A
	Landing Movement Type	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Landing Shared	N/A			
N/A	Clear Space	N/A			
N/A	Clear Space To Crosswalk (in)	N/A			
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	N/A
	Crossing 1 Direction	S		Crossing 2 Direction	N/A
	Marked Crosswalk 1 Width (in)	145		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	Yes	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	5.4		Crossing 2 Slope (%)	N/A
	Crossing 1 Cross Slope (%)	3.3		Crossing 2 Cross Slope (%)	N/A
N/A	Gutter Ponding	N/A	N/A	Curb Slope	13.3
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	N/A
N/A	Gutter Cross Slope (%)	N/A	Yes	Perpendicular Joint Present	Yes
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

