



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: N/A Cross Street: ANTONIO_PKWY Location: N

ADA ID: RPAT220208122628 Ramp Type: Type 1 - Perpendicular Diagonal Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 42

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

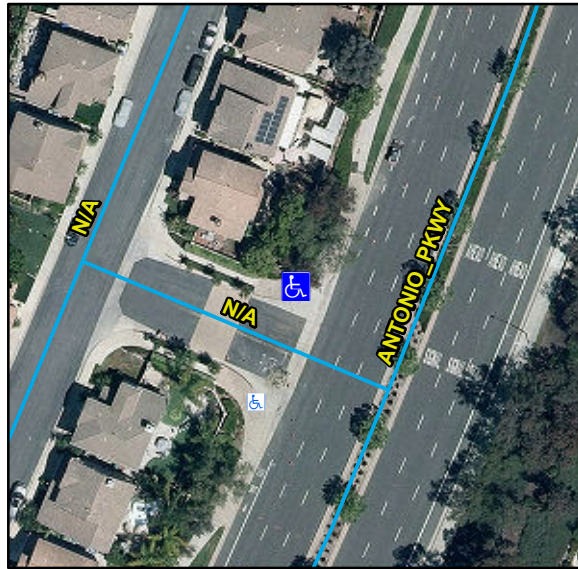

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Grind Gutter Lip.

Surveyor Notes:

N/A

OC Std/PROW:

R302.7, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R305, R302.7.2, STD 1115

Total Cost: \$ 6310

Parcel ID Number 787-211-20

Ramp Island Or Median None

Ramp Orientation Diag

Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.59346337,-117.62547481

Street 1 Name N/A

Stop Condition-Street 1 StopSign

Street 2 Name ANTONIO_PKWY

Stop Condition-Street 2 NoControl

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	91	N/A	Flare Type LT	
Yes	Ramp Width (in)	56			Sloped
Yes	Ramp Run Slope (%)	4.73	Yes	Flare Slope LT (%)	1.7
Yes	Ramp Cross Slope (%)	0.8	N/A	Flare Traversable LT	Yes
N/A	Landing Present	Yes	N/A	Flare Type RT	
N/A	Landing Length (in)	35			Sloped
Yes	Landing Width (in)	56	Yes	Flare Slope RT (%)	8.4
No	Landing Run Slope (%)	4.64	N/A	Flare Traversable RT	Yes
Yes	Landing Cross Slope (%)	0.9	No	DWS Provided	No
N/A	Landing Movement Obstructed?	Yes	N/A	DWS Contrast	N/A
	Landing Movement Type	Bushes	N/A	DWS Length (in)	N/A
N/A	Landing Shared	No	N/A	DWS Full Width	N/A
N/A	Clear Space	Yes	N/A	DWS Offset Left (in)	N/A
N/A	Clear Space To Crosswalk (in)	48	N/A	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	SW		Crossing 2 Direction	SE
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	3.6		Crossing 2 Slope (%)	3
	Crossing 1 Cross Slope (%)	0		Crossing 2 Cross Slope (%)	3.57
Yes	Gutter Ponding	No	Yes	Curb Slope	1.9
No	Gutter Lip Height (in)	1		Road Run Slope (%)	2
Yes	Gutter Run Slope (%)	0.5		Road Cross Slope (%)	3.9
Yes	Gutter Cross Slope (%)	1.7			
No	Overall Surface Condition:	Poor	Yes	Perp Joint Present	Yes
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

