



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: **HAMER_DR** Cross Street: **CARTLEN_DR** Location: **SW**

ADA ID: **RPAT220223095352** Ramp Type: **Type 3 - Combination 1** Initial Pass/Fail: **Fail** Overall Compliance: **No** Severity Score: **0**

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

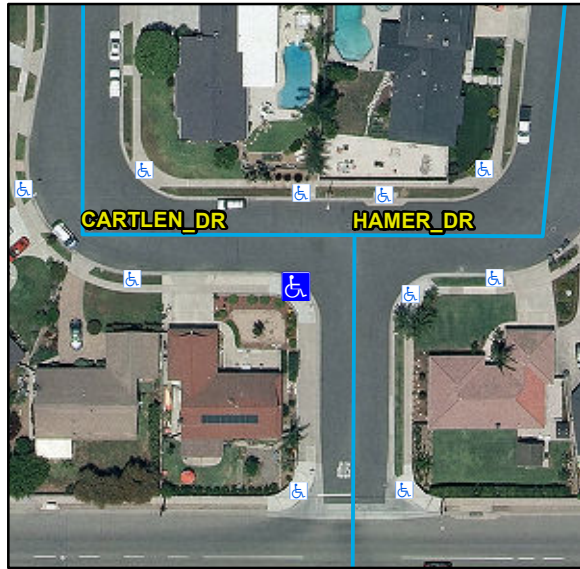

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R304.5.3, STD 1115

Total Cost: \$ **6160**

Parcel ID Number **336-505-19**
Ramp Island Or Median **None**
Ramp Orientation **Diag**
Google Street View Link:

Street 1 Name **HAMER_DR**
Stop Condition-Street 1 **NoControl**
Street 2 Name **CARTLEN_DR**
Stop Condition-Street 2 **NoControl**

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.88979525,-117.84968989

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	52	N/A	Ramp Length RT (in)	72
Yes	Ramp Width LT (in)	82	Yes	Ramp Width RT (in)	52
Yes	Ramp Run Slope LT (%)	2.2	Yes	Ramp Run Slope RT (%)	5.9
Yes	Ramp Cross Slope LT (%)	0.4	No	Ramp Cross Slope RT (%)	2.1
N/A	Ramp Length (in)	61	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			N/A
Yes	Ramp Run Slope (%)	6.7	N/A	Flare Slope LT (%)	N/A
Yes	Ramp Cross Slope (%)	1.6	N/A	Flare Traversable LT	N/A
N/A	Landing Present	N/A	N/A	Flare Type RT	
N/A	Landing Length (in)	N/A			N/A
N/A	Landing Width (in)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	Flare Traversable RT	N/A
N/A	Landing Cross Slope (%)	N/A	N/A	DWS Provided	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Contrast	N/A
	Landing Movement Type	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Shared	N/A	N/A	DWS Full Width	N/A
N/A	Clear Space	No		DWS Offset Type	N/A
N/A	Clear Space To Crosswalk (in)	N/A	N/A	DWS Offset Left (in)	N/A
			N/A	DWS Offset Right (in)	N/A
Yes	Perp Joint Present	Yes			
	Parallel Ramp Side	N/A			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	E		Crossing 2 Direction	N
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	8.7		Crossing 2 Slope (%)	5
	Crossing 1 Cross Slope (%)	0.7		Crossing 2 Cross Slope (%)	7.3
N/A	Gutter Ponding	N/A	No	Curb Slope	13.4
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	3.6
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	9.6
N/A	Gutter Cross Slope (%)	N/A			
Yes	Overall Surface Condition: Acceptable				
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

