




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: CRAWFORD_CANYON_RD		Cross Street: N/A		Location:	NE
ADA ID: RPAT220225151044	Ramp Type:Type 1 - Perpendicular	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score:	5
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		

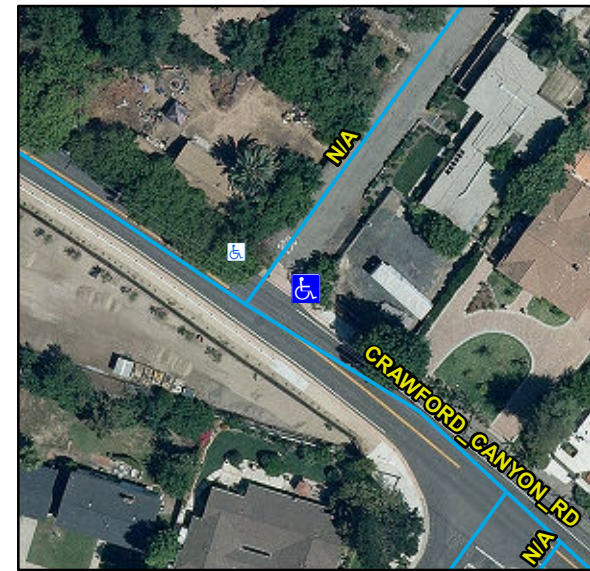

Possible Solutions:

**Remove & Replace Detectable Warning System.
Utility Present.**

Surveyor Notes:

N/A

OC Std/PROW:

R305.1.4, STD 1115

Total Cost: \$ 800

Parcel ID Number 393-121-20
Ramp Island Or Median None
Ramp Orientation NonDiag
Google Street View Link:

Street 1 Name CRAWFORD_CANYON_RD
Stop Condition-Street 1 StopSign
Street 2 Name N/A
Stop Condition-Street 2 N/A

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.77797463,-117.78953182

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	Yes
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A		ManHole	

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	120	N/A	Flare Type LT	
Yes	Ramp Width (in)	85			None
Yes	Ramp Run Slope (%)	8	N/A	Flare Slope LT (%)	N/A
Yes	Ramp Cross Slope (%)	1.6	N/A	Flare Traversable LT	N/A
N/A	Landing Present	Yes	N/A	Flare Type RT	
N/A	Landing Length (in)	87			None
Yes	Landing Width (in)	66	N/A	Flare Slope RT (%)	N/A
Yes	Landing Run Slope (%)	1.7	N/A	Flare Traversable RT	N/A
Yes	Landing Cross Slope (%)	0.2	Yes	DWS Provided	Yes
N/A	Landing Movement Obstructed?	No	Yes	DWS Contrast	Yes
	Landing Movement Type	N/A	Yes	DWS Length (in)	36
N/A	Landing Shared	Yes	No	DWS Full Width	No
N/A	Clear Space	N/A	Yes	DWS Offset Left (in)	0
N/A	Clear Space To Crosswalk (in)	N/A	Yes	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	N/A
	Crossing 1 Direction	W		Crossing 2 Direction	N/A
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	2.1		Crossing 2 Slope (%)	N/A
	Crossing 1 Cross Slope (%)	1		Crossing 2 Cross Slope (%)	N/A
Yes	Gutter Ponding	No	Yes	Curb Slope	0.1
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
Yes	Gutter Run Slope (%)	1.9		Road Cross Slope (%)	N/A
Yes	Gutter Cross Slope (%)	1.2			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

