




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: CRAWFORD_CANYON_RD		Cross Street: CRAWFORD_CANYON_RD		Location:	SW
ADA ID: RPAT220225154859	Ramp Type: Type 6 - Directional 1	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score:	6

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

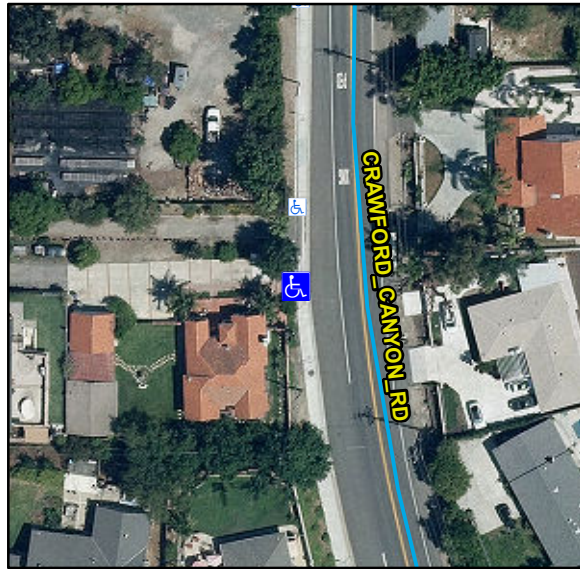

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

OC Std/PROW:

R304.5.3, R305.1.4, STD 1115

Total Cost: \$ 3080

Parcel ID Number 393-462-09
Ramp Island Or Median None
Ramp Orientation NonDiag
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.78352764,-117.79591194

Street 1 Name CRAWFORD_CANYON_RD
Stop Condition-Street 1 NoControl
Street 2 Name CRAWFORD_CANYON_RD
Stop Condition-Street 2 N/A

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	120	N/A	Flare Type LT	
Yes	Ramp Width (in)	64			Sloped
Yes	Ramp Run Slope (%)	6.1	Yes	Flare Slope LT (%)	4.7
Yes	Ramp Cross Slope (%)	2	N/A	Flare Traversable LT	Yes
Yes	Grade Break	Yes	Yes	Flare Type RT	
Yes	Grade Break Slope (%)	0.3			Curbed2
No	Grade Break Cross Slope (%)	2.8	N/A	Flare Slope RT (%)	N/A
	Addl Para Ramp Left?	No	N/A	Flare Traversable RT	N/A
	Addl Para Ramp Right?	No	Yes	DWS Provided	Yes
N/A	Landing Present	Yes	Yes	DWS Contrast	Yes
Yes	Landing Length (in)	60	Yes	DWS Length (in)	36
Yes	Landing Width (in)	66	No	DWS Full Width	No
Yes	Landing Run Slope (%)	0.5		DWS Offset Type	Multiple
No	Landing Cross Slope (%)	2.1	Yes	DWS Left Offset (in)	0
N/A	Landing Movement Obstructed?	No	Yes	DWS Right Offset (in)	29
	Landing Movement Type	N/A			
N/A	Landing Shared	Yes			
N/A	Marked Crosswalk 1	No	N/A	Clear Space	N/A
	Crossing 1 Direction	N	N/A	Clear Space To Crosswalk (in)	N/A
	Marked Crosswalk 1 Width (in)	N/A			
N/A	Ramp Inside Crosswalk 1	N/A			
	Crossing 1 Slope (%)	2.8			
	Crossing 1 Cross Slope (%)	2.6			
Yes	Gutter Ponding	No	Yes	Curb Slope	0.3
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
Yes	Gutter Run Slope (%)	3.2		Road Cross Slope (%)	N/A
Yes	Gutter Cross Slope (%)	2.6		Parallel Ramp Side	N/A
Yes	Overall Surface Condition	Acceptable	Yes	Perp Joint Present	Yes
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

