



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: ARROYO_AVE Cross Street: ARROYO_LINDO_DR Location: SE

ADA ID: RPAT220225165135 Ramp Type: Type 4 - Parallel Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 6

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

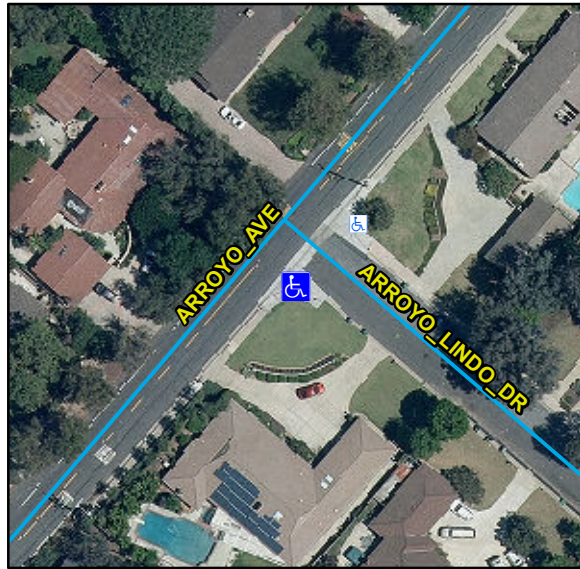

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.5.3, R304.2.1, R304.5.4, STD 1115

Total Cost: \$ 4252

Parcel ID Number 502-154-16
Ramp Island Or Median None
Ramp Orientation Diag
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.75988794,-117.79468363

Street 1 Name ARROYO_AVE
Stop Condition-Street 1 NoControl
Street 2 Name ARROYO_LINDO_DR
Stop Condition-Street 2 NoControl

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	105	N/A	Ramp Length RT (in)	100
Yes	Ramp Width LT (in)	57	Yes	Ramp Width RT (in)	57
Yes	Ramp Run Slope LT (%)	7.1	Yes	Ramp Run Slope RT (%)	4.3
No	Ramp Cross Slope LT (%)	2.6	Yes	Ramp Cross Slope RT (%)	1.3
N/A	Landing Present	Yes	Yes	DWS Provided	Yes
N/A	Landing Length (in)	57	Yes	DWS Contrast	Yes
Yes	Landing Width (in)	48	Yes	DWS Length (in)	36
Yes	Landing Run Slope (%)	1.1	Yes	DWS Full Width	Yes
Yes	Landing Cross Slope (%)	1.6		DWS Offset Type	Single
N/A	Landing Movement Obstructed?	Yes	Yes	DWS Offset Left (in)	2
	Landing Movement Type	Curb	Yes	DWS Offset Right (in)	N/A
N/A	Landing Shared	No			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	N		Crossing 2 Direction	E
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	0.8		Crossing 2 Slope (%)	2.6
	Crossing 1 Cross Slope (%)	4.7		Crossing 2 Cross Slope (%)	8
Yes	Gutter Ponding	No	N/A	Curb Slope	2.6
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	3.6
No	Gutter Run Slope (%)	6.5		Road Cross Slope (%)	1.4
Yes	Gutter Cross Slope (%)	1.8	Yes	Perpendicular Joint Present	Yes
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

