



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: MACMURRAY_ST Cross Street: SYRACUSE_AVE Location: SW

ADA ID: RPRK210921151300 Ramp Type: Type 1 - Perpendicular Diagonal Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 10

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

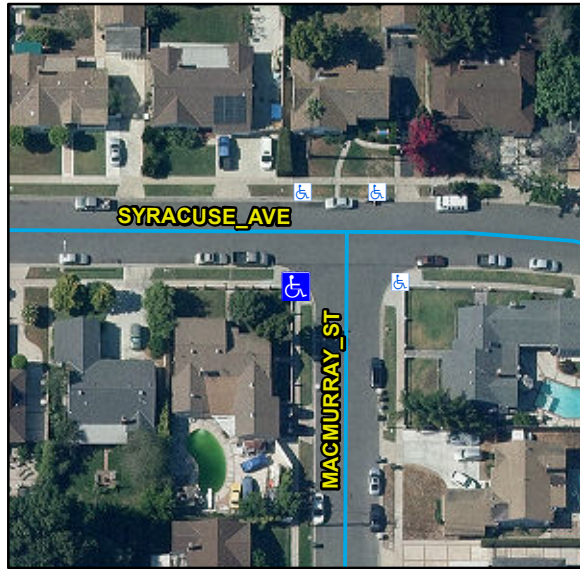

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R204.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R302.7, STD 1115

Total Cost: \$ 6412

Parcel ID Number 126-493-09
Ramp Island Or Median None
Ramp Orientation Diag
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.80528018,-117.97739365

Street 1 Name MACMURRAY_ST
Stop Condition-Street 1 NoControl
Street 2 Name SYRACUSE_AVE
Stop Condition-Street 2 NoControl

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	71	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			Sloped
Yes	Ramp Run Slope (%)	2.1	N/A	Flare Slope LT (%)	6.3
Yes	Ramp Cross Slope (%)	1	N/A	Flare Traversable LT	No
N/A	Landing Present	No	N/A	Flare Type RT	
N/A	Landing Length (in)	N/A			Sloped
No	Landing Width (in)	N/A	N/A	Flare Slope RT (%)	6.4
No	Landing Run Slope (%)	N/A	N/A	Flare Traversable RT	No
No	Landing Cross Slope (%)	N/A	Yes	DWS Provided	Yes
N/A	Landing Movement Obstructed?	Yes	Yes	DWS Contrast	Yes
	Landing Movement Type	Curb	Yes	DWS Length (in)	37
N/A	Landing Shared	N/A	Yes	DWS Full Width	Yes
N/A	Clear Space	Yes	Yes	DWS Offset Left (in)	0
N/A	Clear Space To Crosswalk (in)	48	Yes	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	E		Crossing 2 Direction	N
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	0.5		Crossing 2 Slope (%)	0.7
	Crossing 1 Cross Slope (%)	4.9		Crossing 2 Cross Slope (%)	4.5
No	Gutter Ponding	Yes	No	Curb Slope	6.3
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	4.2
Yes	Gutter Run Slope (%)	0.1		Road Cross Slope (%)	0.2
No	Gutter Cross Slope (%)	8.6			
Yes	Overall Surface Condition: Acceptable		No	Perp Joint Present	No
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

