




# Access Compliance Report Public Rights-of-Way (Curb Ramps)



**Main Street:** MAGNOLIA\_AVE      **Cross Street:** MAGNOLIA\_AVE      **Location:** W

**ADA ID:** RPRK210921155934      **Ramp Type:** Type 4 - Parallel      **Initial Pass/Fail:** Fail      **Overall Compliance:** No      **Severity Score:** 2

**Codes/Mitigation Info/Possible Solution**      **Field Measurements/Component Compliance**

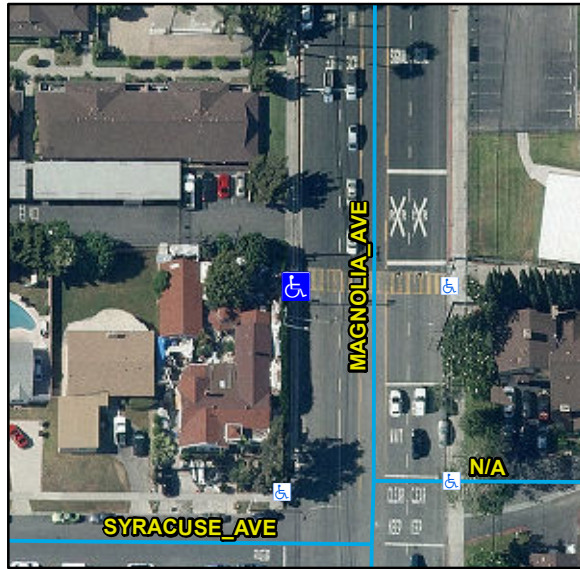

**Possible Solutions:**  
**Remove & Replace Entire Ramp.**

**Surveyor Notes:**  
 N/A

**OC Std/PROW:**  
 R304.5.3, STD 1115

**Total Cost:**      \$      2000

**Parcel ID Number:** 126-491-36  
**Ramp Island Or Median:** None  
**Ramp Orientation:** NonDiag  
**Google Street View Link:**  
[http://www.google.com/maps/@?api=1&map\\_action=pano&viewpoint=33.80567764,-117.97582202](http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.80567764,-117.97582202)

**Street 1 Name:** MAGNOLIA\_AVE  
**Stop Condition-Street 1:** Signal  
**Street 2 Name:** MAGNOLIA\_AVE  
**Stop Condition-Street 2:** N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	87	N/A	Ramp Length RT (in)	88
Yes	Ramp Width LT (in)	88	Yes	Ramp Width RT (in)	86
Yes	Ramp Run Slope LT (%)	5.9	Yes	Ramp Run Slope RT (%)	5.9
Yes	Ramp Cross Slope LT (%)	0.9	No	Ramp Cross Slope RT (%)	2.8
N/A	Landing Present	N/A	N/A	DWS Provided	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Contrast	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	DWS Full Width	N/A
N/A	Landing Cross Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Offset Left (in)	N/A
	Landing Movement Type	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Landing Shared	N/A			
N/A	Clear Space	N/A			
N/A	Clear Space To Crosswalk (in)	N/A			
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	N/A
	Crossing 1 Direction	E		Crossing 2 Direction	N/A
N/A	Marked Crosswalk 1 Width (in)	140		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	Yes	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	6.8		Crossing 2 Slope (%)	N/A
	Crossing 1 Cross Slope (%)	0.2		Crossing 2 Cross Slope (%)	N/A
N/A	Gutter Ponding	N/A	N/A	Curb Slope	5.8
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	N/A
N/A	Gutter Cross Slope (%)	N/A	Yes	Perpendicular Joint Present	Yes
Yes	Overall Surface Condition	Acceptable		Spandrel Present?	No
	Cross Gutter Present?	No		Replace Spandrel?	N/A
	Replace Cross Gutter?	N/A			

**Obstruction and Utility Measurement/Component Compliance**

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

