



# Access Compliance Report Public Rights-of-Way (Curb Ramps)




**Main Street:** GILBERT\_ST      **Cross Street:** CHANTICLEER\_RD      **Location:** NW

**ADA ID:** RPRK210923123226      **Ramp Type:** Type 4 - Parallel      **Initial Pass/Fail:** Pass      **Overall Compliance:** No      **Severity Score:** 6

**Codes/Mitigation Info/Possible Solution**

**Field Measurements/Component Compliance**

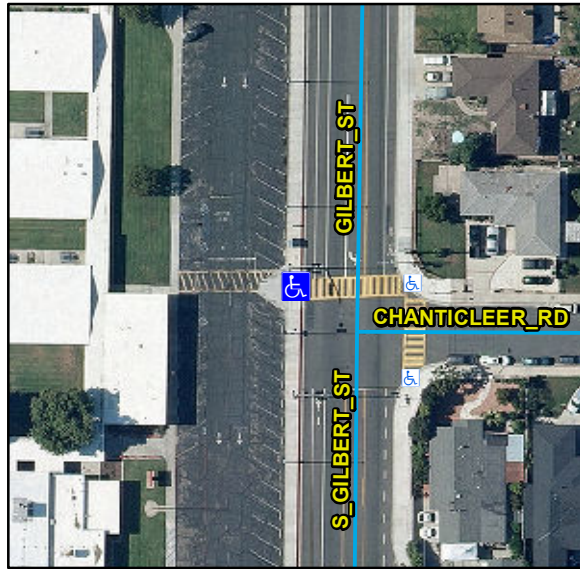

**Possible Solutions:**  
**Remove & Replace Landing. Remove & Replace Gutter.**

**Surveyor Notes:**  
 N/A

**OC Std/PROW:**  
 R304.2.2-Perp, R304.3.2-Para, R304.5.3, STD 1115

**Total Cost:**      \$      783

**Parcel ID Number:** 127-420-01  
**Ramp Island Or Median:** None  
**Ramp Orientation:** NonDiag  
**Google Street View Link:**  
[http://www.google.com/maps/@?api=1&map\\_action=pano&viewpoint=33.812686,-117.96771532](http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.812686,-117.96771532)

**Street 1 Name:** GILBERT\_ST  
**Stop Condition-Street 1:** Signal  
**Street 2 Name:** CHANTICLEER\_RD  
**Stop Condition-Street 2:** N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	95	N/A	Ramp Length RT (in)	100
Yes	Ramp Width LT (in)	69	Yes	Ramp Width RT (in)	70
Yes	Ramp Run Slope LT (%)	7.9	Yes	Ramp Run Slope RT (%)	5.1
Yes	Ramp Cross Slope LT (%)	0	Yes	Ramp Cross Slope RT (%)	2
N/A	Landing Present	Yes	Yes	DWS Provided	Yes
N/A	Landing Length (in)	100	Yes	DWS Contrast	Yes
Yes	Landing Width (in)	48	Yes	DWS Length (in)	36
No	Landing Run Slope (%)	7.6	Yes	DWS Full Width	Yes
Yes	Landing Cross Slope (%)	1.3		DWS Offset Type	Single
N/A	Landing Movement Obstructed?	No	Yes	DWS Offset Left (in)	0
	Landing Movement Type	Curb	Yes	DWS Offset Right (in)	N/A
N/A	Landing Shared	No			
N/A	Clear Space	N/A			
N/A	Clear Space To Crosswalk (in)	N/A			
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	N/A
	Crossing 1 Direction	E		Crossing 2 Direction	N/A
	Marked Crosswalk 1 Width (in)	135		Marked Crosswalk 2 Width (in)	N/A
Yes	Ramp Inside Crosswalk 1	Yes	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	4.7		Crossing 2 Slope (%)	N/A
	Crossing 1 Cross Slope (%)	0.2		Crossing 2 Cross Slope (%)	N/A
Yes	Gutter Ponding	No	Yes	Curb Slope	7.6
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
Yes	Gutter Run Slope (%)	0.4		Road Cross Slope (%)	N/A
No	Gutter Cross Slope (%)	5.6	Yes	Perpendicular Joint Present	Yes
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

**Obstruction and Utility Measurement/Component Compliance**

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

