



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: THISTLE_RD Cross Street: THISTLE_RD Location: NW

ADA ID: RPRK210924145808 Ramp Type: Type 6 - Directional 1 Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 0

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

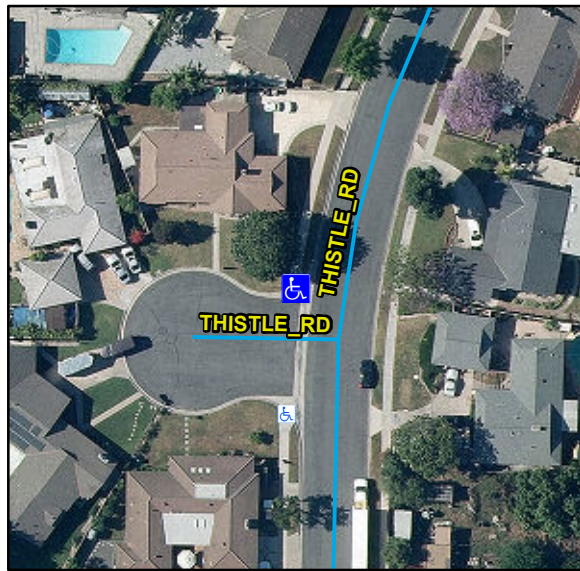

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

OC Std/PROW:

R304.5.2, STD 1115

Total Cost:

\$ 531

Parcel ID Number 127-101-09

Ramp Island Or Median None

Ramp Orientation NonDiag

Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.82581817,-117.96164225

Street 1 Name THISTLE_RD

Stop Condition-Street 1 NoControl

Street 2 Name THISTLE_RD

Stop Condition-Street 2 N/A

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	140	Yes	Flare Type LT	Curbed2
Yes	Ramp Width (in)	60			
Yes	Ramp Run Slope (%)	5.3	N/A	Flare Slope LT (%)	N/A
Yes	Ramp Cross Slope (%)	0.1	N/A	Flare Traversable LT	N/A
No	Grade Break	No	N/A	Flare Type RT	
N/A	Grade Break Slope (%)	N/A			Sloped
N/A	Grade Break Cross Slope (%)	N/A	N/A	Flare Slope RT (%)	N/A
	Addl Para Ramp Left?	No	N/A	Flare Traversable RT	No
	Addl Para Ramp Right?	No	Yes	DWS Provided	Yes
N/A	Landing Present	Yes	Yes	DWS Contrast	Yes
Yes	Landing Length (in)	100	Yes	DWS Length (in)	36
Yes	Landing Width (in)	60	Yes	DWS Full Width	Yes
Yes	Landing Run Slope (%)	0.8		DWS Offset Type	Single
Yes	Landing Cross Slope (%)	1.3	Yes	DWS Left Offset (in)	0
N/A	Landing Movement Obstructed?	No	N/A	DWS Right Offset (in)	0
	Landing Movement Type	N/A			
N/A	Landing Shared	No			
N/A	Marked Crosswalk 1	No	N/A	Clear Space	N/A
	Crossing 1 Direction	S	N/A	Clear Space To Crosswalk (in)	N/A
N/A	Marked Crosswalk 1 Width (in)	N/A			
N/A	Ramp Inside Crosswalk 1	N/A			
	Crossing 1 Slope (%)	1.6			
	Crossing 1 Cross Slope (%)	4.2			
Yes	Gutter Ponding	No	Yes	Curb Slope	4.2
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
Yes	Gutter Run Slope (%)	2.9		Road Cross Slope (%)	N/A
Yes	Gutter Cross Slope (%)	1.6		Parallel Ramp Side	N/A
Yes	Overall Surface Condition	Acceptable	Yes	Perp Joint Present	Yes
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

