




# Access Compliance Report Public Rights-of-Way (Curb Ramps)



**Main Street:** THISTLE\_RD      **Cross Street:** RAMM\_DR      **Location:** N

**ADA ID:** RPRK210924172140      **Ramp Type:** Type 6 - Directional 1      **Initial Pass/Fail:** Fail      **Overall Compliance:** No      **Severity Score:** 2

**Codes/Mitigation Info/Possible Solution**      **Field Measurements/Component Compliance**

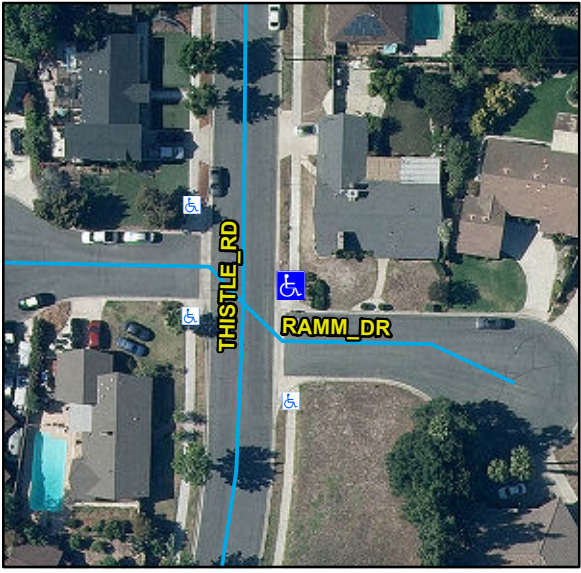

**Possible Solutions:**  
**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

**Surveyor Notes:**  
 N/A

**OC Std/PROW:**  
**R304.5.3, STD 1115**

**Total Cost:**      \$      **3080**

**Parcel ID Number:** 127-092-06  
**Ramp Island Or Median:** None  
**Ramp Orientation:** Diag  
**Google Street View Link:**  
[http://www.google.com/maps/@?api=1&map\\_action=pano&viewpoint=33.82720722,-117.9610539](http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.82720722,-117.9610539)

**Street 1 Name:** THISTLE\_RD  
**Stop Condition-Street 1:** NoControl  
**Street 2 Name:** RAMM\_DR  
**Stop Condition-Street 2:** NoControl

**Obstruction and Utility Measurement/Component Compliance**

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	103	N/A	Flare Type LT	
Yes	Ramp Width (in)	60			N/A
Yes	Ramp Run Slope (%)	5.6	N/A	Flare Slope LT (%)	N/A
No	Ramp Cross Slope (%)	4	N/A	Flare Traversable LT	N/A
N/A	Grade Break	N/A	N/A	Flare Type RT	
N/A	Grade Break Slope (%)	N/A			N/A
N/A	Grade Break Cross Slope (%)	N/A	N/A	Flare Slope RT (%)	N/A
	Addl Para Ramp Left?	No	N/A	Flare Traversable RT	N/A
	Addl Para Ramp Right?	No	N/A	DWS Provided	N/A
N/A	Landing Present	N/A	N/A	DWS Contrast	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Full Width	N/A
N/A	Landing Run Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Cross Slope (%)	N/A	N/A	DWS Left Offset (in)	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Right Offset (in)	N/A
	Landing Movement Type	N/A			
N/A	Landing Shared	N/A			
N/A	Marked Crosswalk 1	No	N/A	Clear Space	Yes
	Crossing 1 Direction	W	N/A	Clear Space To Crosswalk (in)	N/A
	Marked Crosswalk 1 Width (in)	N/A			
N/A	Ramp Inside Crosswalk 1	N/A			
	Crossing 1 Slope (%)	8.4			
	Crossing 1 Cross Slope (%)	1.5			
N/A	Gutter Ponding	N/A	N/A	Curb Slope	1
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	1
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	0.8
N/A	Gutter Cross Slope (%)	N/A		Parallel Ramp Side	Left
Yes	Overall Surface Condition	Acceptable	Yes	Perp Joint Present	Yes
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

