



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: THERESA_AVE Cross Street: THISTLE_RD Location: S

ADA ID: RPRK210924174411 Ramp Type: Type 6 - Directional 1 Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 6

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

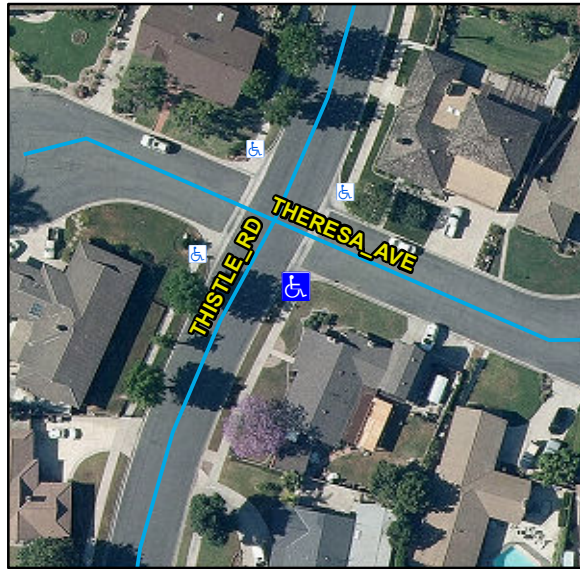

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2-Perp, R304.3.2-Para, R304.2.3, R304.5.4, STD 1115

Total Cost: \$ 3332

Parcel ID Number	127-102-08	Street 1 Name	THERESA_AVE
Ramp Island Or Median	None	Stop Condition-Street 1	NoControl
Ramp Orientation	Diag	Street 2 Name	THISTLE_RD
Google Street View Link:		Stop Condition-Street 2	NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.82629501,-117.96128086

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	93	No	Flare Type LT	
Yes	Ramp Width (in)	60			Curbed1
Yes	Ramp Run Slope (%)	3.4	N/A	Flare Slope LT (%)	N/A
Yes	Ramp Cross Slope (%)	1.6	N/A	Flare Traversable LT	N/A
Yes	Grade Break	Yes	N/A	Flare Type RT	
Yes	Grade Break Slope (%)	1.3			Sloped
Yes	Grade Break Cross Slope (%)	1.1	N/A	Flare Slope RT (%)	5.9
	Addl Para Ramp Left?	No	N/A	Flare Traversable RT	No
	Addl Para Ramp Right?	No	Yes	DWS Provided	Yes
N/A	Landing Present	Yes	Yes	DWS Contrast	Yes
Yes	Landing Length (in)	84	Yes	DWS Length (in)	88
Yes	Landing Width (in)	60	Yes	DWS Full Width	Yes
No	Landing Run Slope (%)	3.1		DWS Offset Type	Single
Yes	Landing Cross Slope (%)	2.5	Yes	DWS Left Offset (in)	0
N/A	Landing Movement Obstructed?	No	N/A	DWS Right Offset (in)	0
	Landing Movement Type	N/A			
N/A	Landing Shared	No			
N/A	Marked Crosswalk 1	No	N/A	Clear Space	Yes
	Crossing 1 Direction	NE	N/A	Clear Space To Crosswalk (in)	48
	Marked Crosswalk 1 Width (in)	N/A			
N/A	Ramp Inside Crosswalk 1	N/A			
	Crossing 1 Slope (%)	3.2			
	Crossing 1 Cross Slope (%)	1.1			
Yes	Gutter Ponding	No	Yes	Curb Slope	6.6
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	5.3
No	Gutter Run Slope (%)	5.4		Road Cross Slope (%)	1.9
Yes	Gutter Cross Slope (%)	1.6		Parallel Ramp Side	Left
Yes	Overall Surface Condition	Acceptable	Yes	Perp Joint Present	Yes
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

