



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: GILBERT_ST Cross Street: RANDOM_DR Location: NE

ADA ID: RPRK210927134232 Ramp Type: Type 6 - Directional 1 Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 0

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

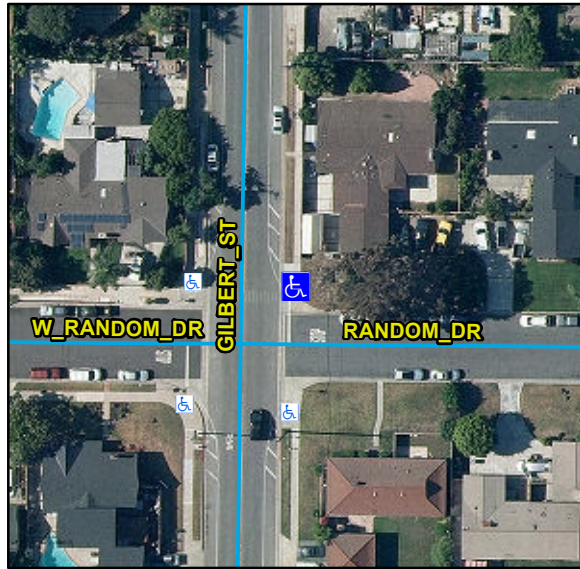

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R204.3, R304.5.2, R304.5.3, STD 1115

Total Cost: \$ 3332

Parcel ID Number 127-211-06
Ramp Island Or Median None
Ramp Orientation Diag
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.82424771,-117.96753901

Street 1 Name GILBERT_ST
Stop Condition-Street 1 NoControl
Street 2 Name RANDOM_DR
Stop Condition-Street 2 StopSign

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	140	N/A	Flare Type LT	
Yes	Ramp Width (in)	78			Sloped
Yes	Ramp Run Slope (%)	2.4	Yes	Flare Slope LT (%)	8.3
Yes	Ramp Cross Slope (%)	0.8	N/A	Flare Traversable LT	Yes
No	Grade Break	No	Yes	Flare Type RT	
N/A	Grade Break Slope (%)	N/A			Curbed2
N/A	Grade Break Cross Slope (%)	N/A	N/A	Flare Slope RT (%)	N/A
	Addl Para Ramp Left?	No	N/A	Flare Traversable RT	N/A
	Addl Para Ramp Right?	No	Yes	DWS Provided	Yes
N/A	Landing Present	Yes	Yes	DWS Contrast	Yes
Yes	Landing Length (in)	69	Yes	DWS Length (in)	67
Yes	Landing Width (in)	48	Yes	DWS Full Width	Yes
Yes	Landing Run Slope (%)	0.9		DWS Offset Type	Single
Yes	Landing Cross Slope (%)	0.8	Yes	DWS Left Offset (in)	0
N/A	Landing Movement Obstructed?	No	N/A	DWS Right Offset (in)	0
	Landing Movement Type	N/A			
N/A	Landing Shared	No			
N/A	Marked Crosswalk 1	No	N/A	Clear Space	Yes
	Crossing 1 Direction	W	N/A	Clear Space To Crosswalk (in)	48
N/A	Marked Crosswalk 1 Width (in)	N/A			
N/A	Ramp Inside Crosswalk 1	N/A			
	Crossing 1 Slope (%)	8.2			
	Crossing 1 Cross Slope (%)	2.9			
Yes	Gutter Ponding	No	Yes	Curb Slope	4.2
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	4.6
Yes	Gutter Run Slope (%)	1.4		Road Cross Slope (%)	5.8
No	Gutter Cross Slope (%)	4.2		Parallel Ramp Side	Right
Yes	Overall Surface Condition	Acceptable	No	Perp Joint Present	No
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

