




# Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: **S\_GILBERT\_ST** Cross Street: **COLCHESTER\_DR** Location: **NE**

ADA ID: **RPRK210927143212** Ramp Type: **Type 1 - Perpendicular Diagonal** Initial Pass/Fail: **Fail** Overall Compliance: **No** Severity Score: **16**

**Codes/Mitigation Info/Possible Solution** **Field Measurements/Component Compliance**

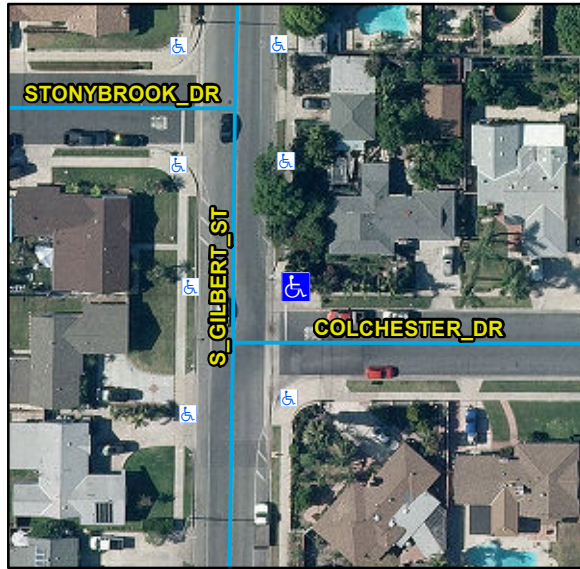

Possible Solutions:  
**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:  
**N/A**

OC Std/PROW:  
**R304.2.2, R204.3, R304.5.3, STD 1115**

Total Cost: **\$ 6160**

Parcel ID Number: **127-282-10**  
 Ramp Island Or Median: **None**  
 Ramp Orientation: **Diag**  
 Google Street View Link:  
[http://www.google.com/maps/@?api=1&map\\_action=pano&viewpoint=33.82097436,-117.96751762](http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.82097436,-117.96751762)

Street 1 Name: **S\_GILBERT\_ST**  
 Stop Condition-Street 1: **NoControl**  
 Street 2 Name: **COLCHESTER\_DR**  
 Stop Condition-Street 2: **StopSign**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	117	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			N/A
No	Ramp Run Slope (%)	8.7	N/A	Flare Slope LT (%)	N/A
No	Ramp Cross Slope (%)	2.4	N/A	Flare Traversable LT	N/A
N/A	Landing Present	N/A	N/A	Flare Type RT	
N/A	Landing Length (in)	N/A			N/A
N/A	Landing Width (in)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	Flare Traversable RT	N/A
N/A	Landing Cross Slope (%)	N/A	N/A	DWS Provided	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Contrast	N/A
	Landing Movement Type	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Shared	N/A	N/A	DWS Full Width	N/A
N/A	Clear Space	Yes	N/A	DWS Offset Left (in)	N/A
N/A	Clear Space To Crosswalk (in)	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	W		Crossing 2 Direction	S
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	3.3		Crossing 2 Slope (%)	1.7
	Crossing 1 Cross Slope (%)	0.3		Crossing 2 Cross Slope (%)	1.9
N/A	Gutter Ponding	N/A	No	Curb Slope	10.4
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	4.9
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	7.5
N/A	Gutter Cross Slope (%)	N/A			
Yes	Overall Surface Condition: <b>Acceptable</b>		No	Perp Joint Present	No
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

**Obstruction and Utility Measurement/Component Compliance**

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

