



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: BOLSA_AVE Cross Street: VAN_BUREN_ST Location: NW

ADA ID: RPRK210930110927 Ramp Type: Type 1 - Perpendicular Diagonal Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 16

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

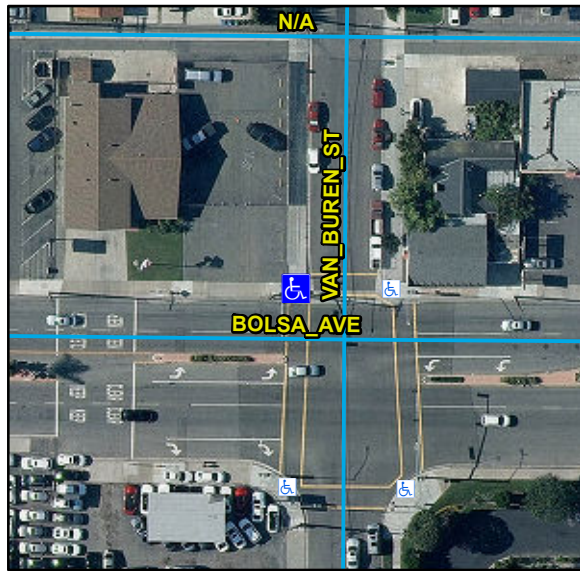

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Restripe Crosswalk. Remove & Replace Gutter. Utility Present.

Surveyor Notes:

N/A

OC Std/PROW:

R304.5.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R207.1, R304.5.4, STD 1115

Total Cost: \$ 10412

Parcel ID Number	097-133-19	Street 1 Name	BOLSA_AVE
Ramp Island Or Median	None	Stop Condition-Street 1	Signal
Ramp Orientation	Diag	Street 2 Name	VAN_BUREN_ST
Google Street View Link:		Stop Condition-Street 2	Signal

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.74481444,-117.98644408

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	Yes
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A		Pull Box; Traffic Signal Pole	

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	107	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			Sloped
Yes	Ramp Run Slope (%)	1.9	N/A	Flare Slope LT (%)	5.7
No	Ramp Cross Slope (%)	2.2	N/A	Flare Traversable LT	No
N/A	Landing Present	No	N/A	Flare Type RT	
N/A	Landing Length (in)	N/A			Sloped
No	Landing Width (in)	N/A	N/A	Flare Slope RT (%)	7.7
No	Landing Run Slope (%)	N/A	N/A	Flare Traversable RT	No
No	Landing Cross Slope (%)	N/A	Yes	DWS Provided	Yes
N/A	Landing Movement Obstructed?	No	Yes	DWS Contrast	Yes
	Landing Movement Type	N/A	Yes	DWS Length (in)	36
N/A	Landing Shared	N/A	Yes	DWS Full Width	Yes
Yes	Clear Space	Yes	Yes	DWS Offset Left (in)	0
Yes	Clear Space To Crosswalk (in)	48	Yes	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	Yes
	Crossing 1 Direction	S		Crossing 2 Direction	E
	Marked Crosswalk 1 Width (in)	140		Marked Crosswalk 2 Width (in)	140
Yes	Ramp Inside Crosswalk 1	Yes	Yes	Ramp Inside Crosswalk 2	No
	Crossing 1 Slope (%)	11.7		Crossing 2 Slope (%)	2
	Crossing 1 Cross Slope (%)	2.3		Crossing 2 Cross Slope (%)	1.1
Yes	Gutter Ponding	No	N/A	Curb Slope	1.9
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	1.1
No	Gutter Run Slope (%)	6.5		Road Cross Slope (%)	2.8
No	Gutter Cross Slope (%)	2.1			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

