




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: WASHINGTON_AVE		Cross Street: NEWLAND_ST		Location:	SE
ADA ID: RPRK211001115139	Ramp Type:Type 1 - Perpendicular Diagonal Initial Pass/Fail: Pass		Overall Compliance: No	Severity Score:	12

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
---	--	--	---	--	--

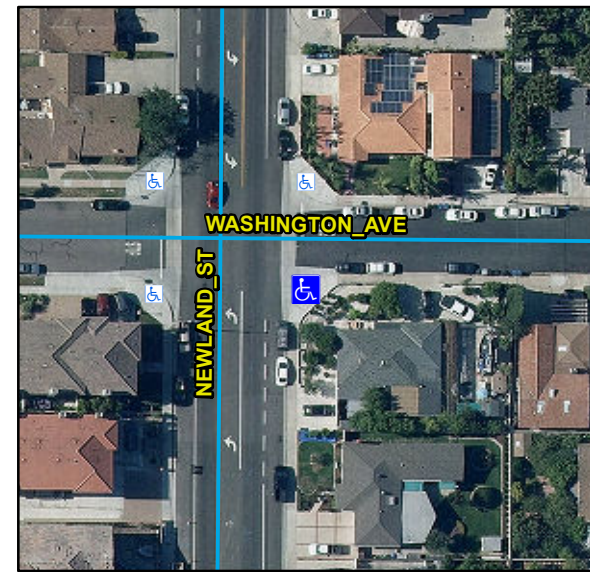

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R304.2.3, STD 1115

Total Cost: \$ 6160

Parcel ID Number	097-452-17	Street 1 Name	WASHINGTON_AVE
Ramp Island Or Median	None	Stop Condition-Street 1	NoControl
Ramp Orientation	Diag	Street 2 Name	NEWLAND_ST
Google Street View Link:		Stop Condition-Street 2	NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.74652628,-117.98080099

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A



Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	117	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			Sloped
Yes	Ramp Run Slope (%)	3.3	Yes	Flare Slope LT (%)	9.4
Yes	Ramp Cross Slope (%)	0.6	N/A	Flare Traversable LT	Yes
N/A	Landing Present	No	N/A	Flare Type RT	
N/A	Landing Length (in)	N/A			Sloped
No	Landing Width (in)	N/A	No	Flare Slope RT (%)	10.2
No	Landing Run Slope (%)	N/A	N/A	Flare Traversable RT	Yes
No	Landing Cross Slope (%)	N/A	Yes	DWS Provided	Yes
N/A	Landing Movement Obstructed?	Yes	Yes	DWS Contrast	Yes
	Landing Movement Type	Curb	Yes	DWS Length (in)	37
N/A	Landing Shared	N/A	Yes	DWS Full Width	Yes
N/A	Clear Space	Yes	Yes	DWS Offset Left (in)	0
N/A	Clear Space To Crosswalk (in)	48	Yes	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	N		Crossing 2 Direction	W
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	5.8		Crossing 2 Slope (%)	1.8
	Crossing 1 Cross Slope (%)	3.8		Crossing 2 Cross Slope (%)	1.6
Yes	Gutter Ponding	No	No	Curb Slope	6.5
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	3.5
Yes	Gutter Run Slope (%)	0.3		Road Cross Slope (%)	6.8
Yes	Gutter Cross Slope (%)	2			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No