




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: ROOSEVELT_AVE Cross Street: BEACH_BLVD Location: SE

ADA ID: RPRK211001145621 Ramp Type: Type 1 - Perpendicular Diagonal Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 20

Codes/Mitigation Info/Possible Solution Field Measurements/Component Compliance

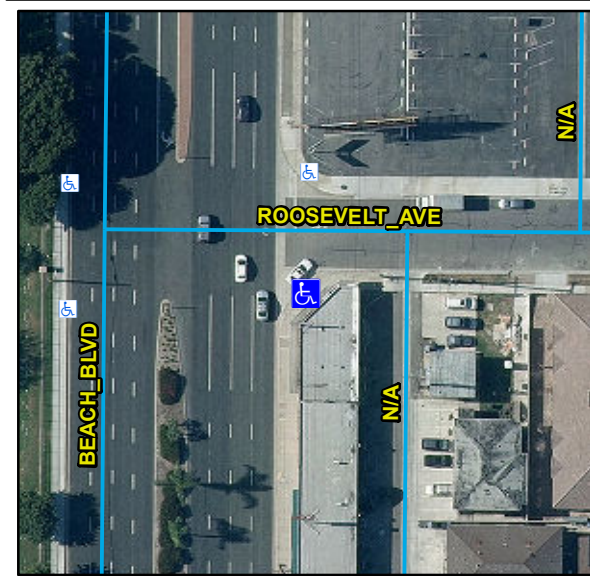

Possible Solutions:
Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:
N/A


OC Std/PROW:
R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R305, STD 1115

Total Cost: \$ 6160

Parcel ID Number 097-111-31
Ramp Island Or Median None
Ramp Orientation Diag
Google Street View Link:
http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.7500896,-117.98931905

Street 1 Name ROOSEVELT_AVE
Stop Condition-Street 1 StopSign
Street 2 Name BEACH_BLVD
Stop Condition-Street 2 NoControl

Obstruction and Utility Measurement/Component Compliance				
Compliance	Description	Data	Compliance	Description
Yes	Obstructions Present?	No	N/A	Utilities Present?
	Obstruction Types	N/A		Utility Types
	Obstruction Dimensions	N/A		N/A

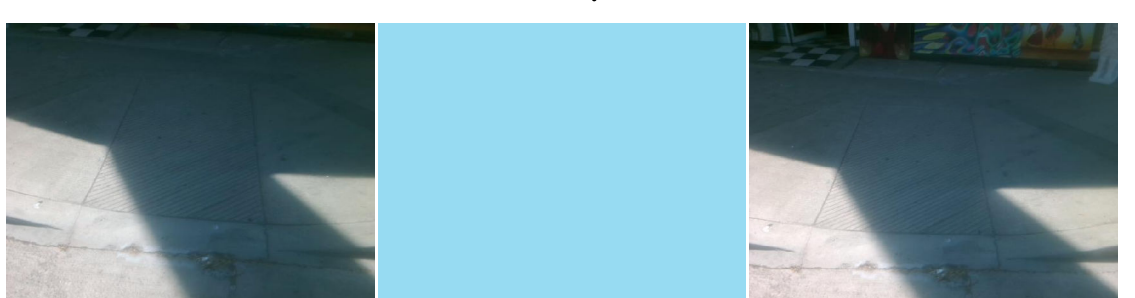

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	120	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			Sloped
Yes	Ramp Run Slope (%)	7.2	Yes	Flare Slope LT (%)	5.6
Yes	Ramp Cross Slope (%)	0.3	N/A	Flare Traversable LT	Yes
N/A	Landing Present	No	N/A	Flare Type RT	
N/A	Landing Length (in)	N/A			Sloped
No	Landing Width (in)	N/A	Yes	Flare Slope RT (%)	7.2
No	Landing Run Slope (%)	N/A	N/A	Flare Traversable RT	Yes
No	Landing Cross Slope (%)	N/A	No	DWS Provided	No
N/A	Landing Movement Obstructed?	No	N/A	DWS Contrast	N/A
	Landing Movement Type	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Shared	N/A	N/A	DWS Full Width	N/A
N/A	Clear Space	Yes	N/A	DWS Offset Left (in)	N/A
N/A	Clear Space To Crosswalk (in)	48	N/A	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	N		Crossing 2 Direction	W
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	2.8		Crossing 2 Slope (%)	0.8
	Crossing 1 Cross Slope (%)	4.2		Crossing 2 Cross Slope (%)	3.8
Yes	Gutter Ponding	No	Yes	Curb Slope	2
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	5.1
Yes	Gutter Run Slope (%)	3.5		Road Cross Slope (%)	7.3
Yes	Gutter Cross Slope (%)	1.6			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A