




# Access Compliance Report Public Rights-of-Way (Curb Ramps)



**Main Street:** EDEN\_ST **Cross Street:** ROOSEVELT\_AVE **Location:** SW

**ADA ID:** RPRK211005121547 **Ramp Type:**Type 1 - Perpendicular Diagonal Initial Pass/Fail: Fail **Overall Compliance:** No **Severity Score:** 15

**Codes/Mitigation Info/Possible Solution** **Field Measurements/Component Compliance**

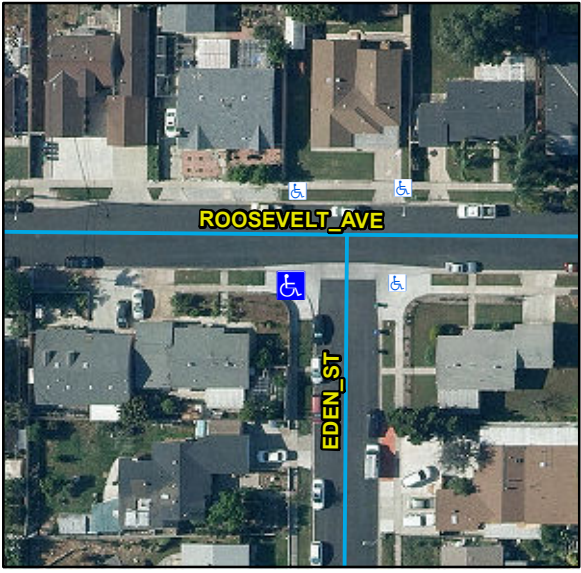

**Possible Solutions:**  
**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

**Surveyor Notes:**  
 N/A

**OC Std/PROW:**  
 R304.2.2, STD 1115

**Total Cost:** \$ 6160

**Parcel ID Number:** 097-483-01  
**Ramp Island Or Median:** None  
**Ramp Orientation:** Diag  
**Google Street View Link:**  
[http://www.google.com/maps/@?api=1&map\\_action=pano&viewpoint=33.74981345,-117.97619473](http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.74981345,-117.97619473)

**Street 1 Name:** EDEN\_ST  
**Stop Condition-Street 1:** NoControl  
**Street 2 Name:** ROOSEVELT\_AVE  
**Stop Condition-Street 2:** NoControl

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	78	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			N/A
No	Ramp Run Slope (%)	9.6	N/A	Flare Slope LT (%)	N/A
Yes	Ramp Cross Slope (%)	1.3	N/A	Flare Traversable LT	N/A
N/A	Landing Present	N/A	N/A	Flare Type RT	
N/A	Landing Length (in)	N/A			N/A
N/A	Landing Width (in)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	Flare Traversable RT	N/A
N/A	Landing Cross Slope (%)	N/A	N/A	DWS Provided	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Contrast	N/A
	Landing Movement Type	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Shared	N/A	N/A	DWS Full Width	N/A
N/A	Clear Space	Yes	N/A	DWS Offset Left (in)	N/A
N/A	Clear Space To Crosswalk (in)	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	E		Crossing 2 Direction	N
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	5		Crossing 2 Slope (%)	2.7
	Crossing 1 Cross Slope (%)	2.4		Crossing 2 Cross Slope (%)	1.8
N/A	Gutter Ponding	N/A	No	Curb Slope	6.1
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	2.5
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	0
N/A	Gutter Cross Slope (%)	N/A			
Yes	Overall Surface Condition:	Acceptable	Yes	Perp Joint Present	Yes
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

**Obstruction and Utility Measurement/Component Compliance**

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

