



Access Compliance Report

Public Rights-of-Way

(Curb Ramps)




Main Street: **DARWIN_AVE** Cross Street: **CEDARWOOD_AVE** Location: **SE**

ADA ID: **RPRK211005180102** Ramp Type: **Type 1 - Perpendicular Diagonal** Initial Pass/Fail: **Fail** Overall Compliance: **No** Severity Score: **15**

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

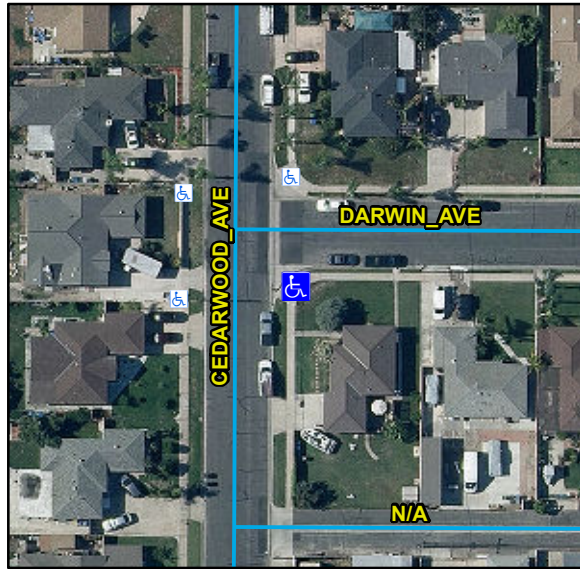

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, STD 1115

Total Cost: \$ **6160**

Parcel ID Number **142-053-09**
Ramp Island Or Median **None**
Ramp Orientation **Diag**
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.73824945,-117.9932734

Street 1 Name **DARWIN_AVE**
Stop Condition-Street 1 **NoControl**
Street 2 Name **CEDARWOOD_AVE**
Stop Condition-Street 2 **NoControl**

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	92	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			N/A
No	Ramp Run Slope (%)	11.1	N/A	Flare Slope LT (%)	N/A
Yes	Ramp Cross Slope (%)	0.8	N/A	Flare Traversable LT	N/A
N/A	Landing Present	N/A	N/A	Flare Type RT	
N/A	Landing Length (in)	N/A			N/A
N/A	Landing Width (in)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	Flare Traversable RT	N/A
N/A	Landing Cross Slope (%)	N/A	N/A	DWS Provided	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Contrast	N/A
	Landing Movement Type	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Shared	N/A	N/A	DWS Full Width	N/A
N/A	Clear Space	Yes	N/A	DWS Offset Left (in)	N/A
N/A	Clear Space To Crosswalk (in)	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	N		Crossing 2 Direction	W
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	4.8		Crossing 2 Slope (%)	3.2
	Crossing 1 Cross Slope (%)	2.8		Crossing 2 Cross Slope (%)	1.3
N/A	Gutter Ponding	N/A	No	Curb Slope	15.7
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	2.9
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	4
N/A	Gutter Cross Slope (%)	N/A			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

