



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: **BROWNING_AVE** Cross Street: **IRVINE_BLVD** Location: **SE**

ADA ID: **RPRK211006110511** Ramp Type: **Type 1 - Perpendicular Diagonal Initial Pass/Fail: Pass** Overall Compliance: **No** Severity Score: **7**

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

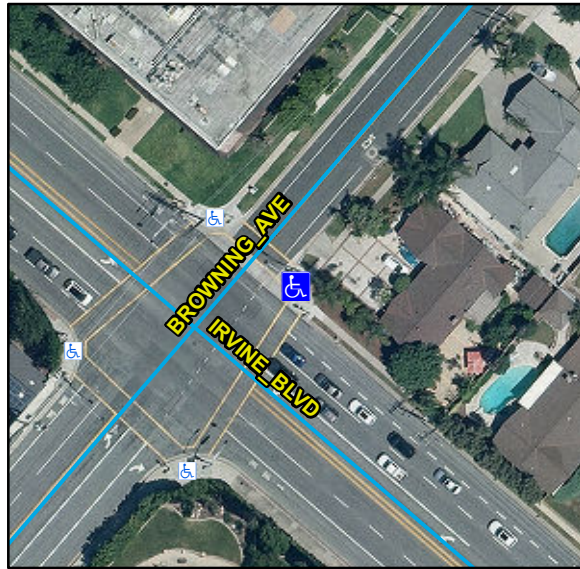

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R302.7, R304.5.4, STD 1115

Total Cost: \$ **6412**

Parcel ID Number **104-471-01**
Ramp Island Or Median **None**
Ramp Orientation **Diag**
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.74011245,-117.79743814

Street 1 Name **BROWNING_AVE**
Stop Condition-Street 1 **Signal**
Street 2 Name **IRVINE_BLVD**
Stop Condition-Street 2 **Signal**

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	92	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			Sloped
Yes	Ramp Run Slope (%)	6.6	N/A	Flare Slope LT (%)	2.6
Yes	Ramp Cross Slope (%)	1.9	N/A	Flare Traversable LT	No
N/A	Landing Present	Yes	N/A	Flare Type RT	
N/A	Landing Length (in)	54			Sloped
Yes	Landing Width (in)	48	N/A	Flare Slope RT (%)	4.5
No	Landing Run Slope (%)	4.8	N/A	Flare Traversable RT	No
Yes	Landing Cross Slope (%)	0.1	Yes	DWS Provided	Yes
N/A	Landing Movement Obstructed?	Yes	Yes	DWS Contrast	Yes
	Landing Movement Type	Curb	Yes	DWS Length (in)	36
N/A	Landing Shared	No	Yes	DWS Full Width	Yes
Yes	Clear Space	Yes	Yes	DWS Offset Left (in)	0
Yes	Clear Space To Crosswalk (in)	48	Yes	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	Yes
	Crossing 1 Direction	NW		Crossing 2 Direction	SW
	Marked Crosswalk 1 Width (in)	145		Marked Crosswalk 2 Width (in)	142
Yes	Ramp Inside Crosswalk 1	Yes	Yes	Ramp Inside Crosswalk 2	Yes
	Crossing 1 Slope (%)	9.9		Crossing 2 Slope (%)	5
	Crossing 1 Cross Slope (%)	4.7		Crossing 2 Cross Slope (%)	0.5
No	Gutter Ponding	Yes	No	Curb Slope	16.8
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	1.5
No	Gutter Run Slope (%)	5.4		Road Cross Slope (%)	2.6
Yes	Gutter Cross Slope (%)	1.1			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

