



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: S_OAKWOOD_ST Cross Street: FAIRHAVEN_AVE Location: NE

ADA ID: RPRK211007112735 Ramp Type: Type 1 - Perpendicular Diagonal Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 15

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

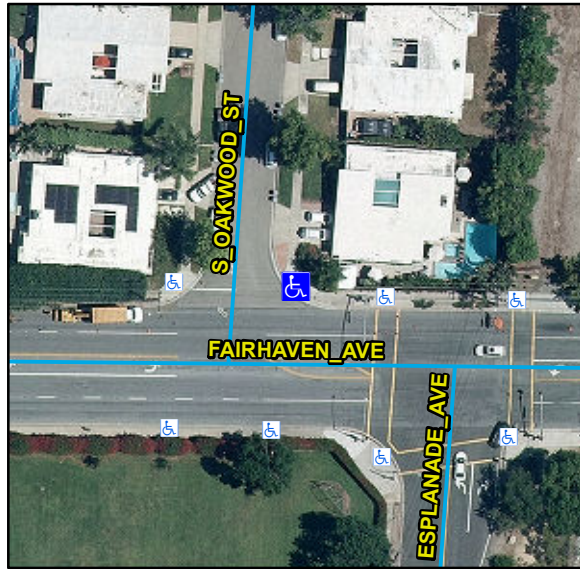

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R304.5.4, STD 1115

Total Cost: \$ 6412

Parcel ID Number 094-122-20
Ramp Island Or Median None
Ramp Orientation Diag
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.77362211,-117.81118677

Street 1 Name S_OAKWOOD_ST
Stop Condition-Street 1 StopSign
Street 2 Name FAIRHAVEN_AVE
Stop Condition-Street 2 NoControl

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	100	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			Sloped
Yes	Ramp Run Slope (%)	7.4	Yes	Flare Slope LT (%)	2.1
Yes	Ramp Cross Slope (%)	0.8	N/A	Flare Traversable LT	Yes
N/A	Landing Present	No	N/A	Flare Type RT	
N/A	Landing Length (in)	N/A			Sloped
No	Landing Width (in)	N/A	Yes	Flare Slope RT (%)	5.5
No	Landing Run Slope (%)	N/A	N/A	Flare Traversable RT	Yes
No	Landing Cross Slope (%)	N/A	Yes	DWS Provided	Yes
N/A	Landing Movement Obstructed?	Yes	Yes	DWS Contrast	Yes
	Landing Movement Type	Curb	Yes	DWS Length (in)	36
N/A	Landing Shared	N/A	Yes	DWS Full Width	Yes
N/A	Clear Space	Yes	Yes	DWS Offset Left (in)	0
N/A	Clear Space To Crosswalk (in)	48	Yes	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	W		Crossing 2 Direction	S
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	4.4		Crossing 2 Slope (%)	2.3
	Crossing 1 Cross Slope (%)	0.2		Crossing 2 Cross Slope (%)	1.1
Yes	Gutter Ponding	No	No	Curb Slope	10.1
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	1.1
No	Gutter Run Slope (%)	10		Road Cross Slope (%)	9.3
Yes	Gutter Cross Slope (%)	1			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

