



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: BRAE_GLEN Cross Street: CRAWFORD_CANYON_RD Location: NW

ADA ID: RPRK211007172336 Ramp Type: Type 1 - Perpendicular Diagonal Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 28

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

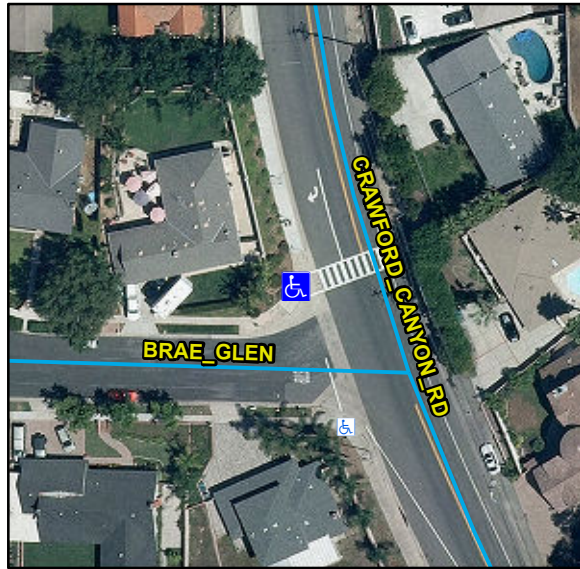

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Restripe Crosswalk. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R204.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R304.2.3, R305, R207.1, R304.5.4, STD 1115

Total Cost: \$ 10412

Parcel ID Number 393-462-08
Ramp Island Or Median None
Ramp Orientation Diag
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.78298063,-117.79578906

Street 1 Name BRAE_GLEN
Stop Condition-Street 1 StopSign
Street 2 Name CRAWFORD_CANYON_RD
Stop Condition-Street 2 NoControl

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	79	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			Sloped
Yes	Ramp Run Slope (%)	8.3	No	Flare Slope LT (%)	11.4
Yes	Ramp Cross Slope (%)	1.9	N/A	Flare Traversable LT	Yes
N/A	Landing Present	No	N/A	Flare Type RT	
N/A	Landing Length (in)	N/A			Sloped
No	Landing Width (in)	N/A	Yes	Flare Slope RT (%)	9.8
No	Landing Run Slope (%)	N/A	N/A	Flare Traversable RT	Yes
No	Landing Cross Slope (%)	N/A	No	DWS Provided	No
N/A	Landing Movement Obstructed?	Yes	N/A	DWS Contrast	N/A
	Landing Movement Type	Curb	N/A	DWS Length (in)	N/A
N/A	Landing Shared	N/A	N/A	DWS Full Width	N/A
N/A	Clear Space	Yes	N/A	DWS Offset Left (in)	N/A
N/A	Clear Space To Crosswalk (in)	48	N/A	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	Yes
	Crossing 1 Direction	S		Crossing 2 Direction	E
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	144
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	No
	Crossing 1 Slope (%)	8.1		Crossing 2 Slope (%)	1.7
	Crossing 1 Cross Slope (%)	5.3		Crossing 2 Cross Slope (%)	1.4
Yes	Gutter Ponding	No	No	Curb Slope	11.8
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	4.8
No	Gutter Run Slope (%)	6		Road Cross Slope (%)	0.1
No	Gutter Cross Slope (%)	4.2			
Yes	Overall Surface Condition: Acceptable		No	Perp Joint Present	No
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

