



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: 17TH_ST Cross Street: WINDSOR_PL Location: SE

ADA ID: RPRK211008123927 Ramp Type: Type 6 - Directional 1 Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 15

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

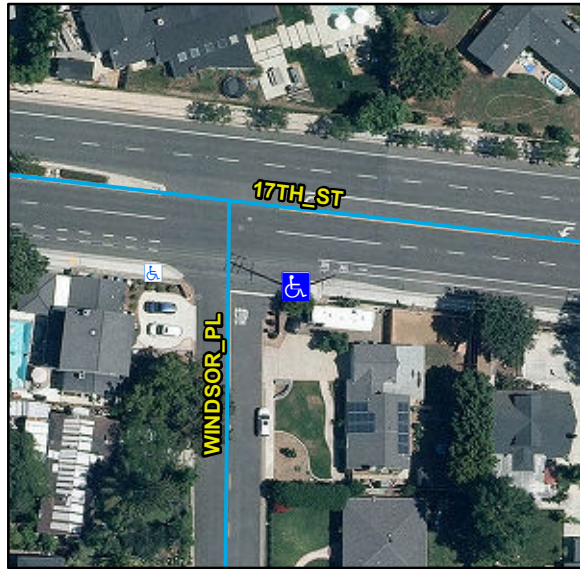

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R302.3, R402.2, STD 1115

Total Cost: \$ 3080

Parcel ID Number 401-071-02
Ramp Island Or Median None
Ramp Orientation Diag
Google Street View Link:

Street 1 Name 17TH_ST
Stop Condition-Street 1 NoControl
Street 2 Name WINDSOR_PL
Stop Condition-Street 2 NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.75934914,-117.80800984

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
No	Obstructions Present?	Yes	N/A	Utilities Present?	No
	Obstruction Types	Power Pole		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	102	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			N/A
No	Ramp Run Slope (%)	11.2	N/A	Flare Slope LT (%)	N/A
Yes	Ramp Cross Slope (%)	3.3	N/A	Flare Traversable LT	N/A
N/A	Grade Break	N/A	N/A	Flare Type RT	
N/A	Grade Break Slope (%)	N/A			N/A
N/A	Grade Break Cross Slope (%)	N/A	N/A	Flare Slope RT (%)	N/A
	Addl Para Ramp Left?	No	N/A	Flare Traversable RT	N/A
	Addl Para Ramp Right?	No	N/A	DWS Provided	N/A
N/A	Landing Present	N/A	N/A	DWS Contrast	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Full Width	N/A
N/A	Landing Run Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Cross Slope (%)	N/A	N/A	DWS Left Offset (in)	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Right Offset (in)	N/A
	Landing Movement Type	N/A			
N/A	Landing Shared	N/A			
N/A	Marked Crosswalk 1	No	N/A	Clear Space	Yes
	Crossing 1 Direction	N	N/A	Clear Space To Crosswalk (in)	N/A
	Marked Crosswalk 1 Width (in)	N/A			
N/A	Ramp Inside Crosswalk 1	N/A			
	Crossing 1 Slope (%)	2.5			
	Crossing 1 Cross Slope (%)	5.3			
N/A	Gutter Ponding	N/A	N/A	Curb Slope	11.7
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	5.4
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	3.5
N/A	Gutter Cross Slope (%)	N/A		Parallel Ramp Side	N/A
Yes	Overall Surface Condition	Acceptable	Yes	Perp Joint Present	Yes
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

