



# Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: BIGELOW\_PKWY Cross Street: HOLT\_AVE Location: SW

ADA ID: RPRK211011125802 Ramp Type: Type 7 - Directional 2 Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 15

## Codes/Mitigation Info/Possible Solution

## Field Measurements/Component Compliance

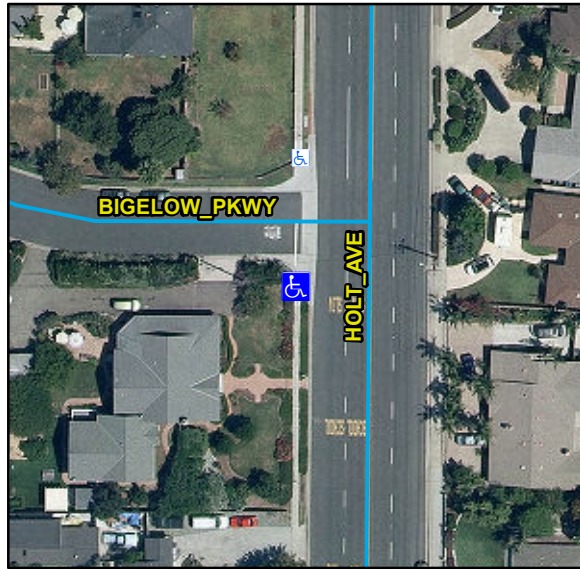

### Possible Solutions:

Remove & Replace Entire Ramp.

### Surveyor Notes:

N/A

### OC Std/PROW:

R204.3, R304.2.2, STD 1115

Total Cost: \$ 3080

Parcel ID Number 401-455-13  
Ramp Island Or Median None  
Ramp Orientation NonDiag  
Google Street View Link:

Street 1 Name BIGELOW\_PKWY  
Stop Condition-Street 1 StopSign  
Street 2 Name HOLT\_AVE  
Stop Condition-Street 2 N/A

[http://www.google.com/maps/@?api=1&map\\_action=pano&viewpoint=33.75530649,-117.81446862](http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.75530649,-117.81446862)

## Obstruction and Utility Measurement/Component Compliance

| Compliance | Description            | Data | Compliance | Description        | Data |
|------------|------------------------|------|------------|--------------------|------|
| Yes        | Obstructions Present?  | No   | N/A        | Utilities Present? | No   |
|            | Obstruction Types      | N/A  |            | Utility Types      |      |
|            | Obstruction Dimensions | N/A  |            |                    | N/A  |

| Compliance | Description                   | Data       | Compliance | Description                   | Data  |
|------------|-------------------------------|------------|------------|-------------------------------|-------|
| N/A        | Ramp Length (in)              | 148        | N/A        | Flare Type LT                 |       |
| Yes        | Ramp Width (in)               | 60         |            |                               | N/A   |
| No         | Ramp Run Slope (%)            | 10.9       | N/A        | Flare Slope LT (%)            | N/A   |
| Yes        | Ramp Cross Slope (%)          | 0.2        | N/A        | Flare Traversable LT          | N/A   |
| N/A        | Grade Break                   | N/A        | N/A        | Flare Type RT                 |       |
| N/A        | Grade Break Slope (%)         | N/A        |            |                               | N/A   |
| N/A        | Grade Break Cross Slope (%)   | N/A        | N/A        | Flare Slope RT (%)            | N/A   |
|            | Addl Para Ramp Left?          | No         | N/A        | Flare Traversable RT          | N/A   |
|            | Addl Para Ramp Right?         | No         | N/A        | DWS Provided                  | N/A   |
| N/A        | Landing Present               | N/A        | N/A        | DWS Contrast                  | N/A   |
| N/A        | Landing Length (in)           | N/A        | N/A        | DWS Length (in)               | N/A   |
| N/A        | Landing Width (in)            | N/A        | N/A        | DWS Full Width                | N/A   |
| N/A        | Landing Run Slope (%)         | N/A        |            | DWS Offset Type               | N/A   |
| N/A        | Landing Cross Slope (%)       | N/A        | N/A        | DWS Left Offset (in)          | N/A   |
| N/A        | Landing Movement Obstructed?  | N/A        | N/A        | DWS Right Offset (in)         | N/A   |
|            | Landing Movement Type         | N/A        |            |                               |       |
| N/A        | Landing Shared                | N/A        |            |                               |       |
| N/A        | Marked Crosswalk 1            | No         | N/A        | Clear Space                   | N/A   |
|            | Crossing 1 Direction          | N          | N/A        | Clear Space To Crosswalk (in) | N/A   |
|            | Marked Crosswalk 1 Width (in) | N/A        |            |                               |       |
| N/A        | Ramp Inside Crosswalk 1       | N/A        |            |                               |       |
|            | Crossing 1 Slope (%)          | 0.5        |            |                               |       |
|            | Crossing 1 Cross Slope (%)    | 1          |            |                               |       |
| N/A        | Gutter Ponding                | N/A        | N/A        | Curb Slope                    | 11.5  |
| Yes        | Gutter Lip Height (in)        | 0          |            | Road Run Slope (%)            | N/A   |
| N/A        | Gutter Run Slope (%)          | N/A        |            | Road Cross Slope (%)          | N/A   |
| N/A        | Gutter Cross Slope (%)        | N/A        |            | Parallel Ramp Side            | Right |
| Yes        | Overall Surface Condition     | Acceptable | No         | Perp Joint Present            | No    |
|            | Cross Gutter Present?         | Yes        |            | Spandrel Present?             | Yes   |
|            | Replace Cross Gutter?         | No         |            | Replace Spandrel?             | No    |

