




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: COUNTRY_LN **Cross Street:** SE_SKYLINE_DR **Location:** E

ADA ID: RPRK211012115048 **Ramp Type:** Type 6 - Directional 1 **Initial Pass/Fail:** Pass **Overall Compliance:** No **Severity Score:** 15

Codes/Mitigation Info/Possible Solution **Field Measurements/Component Compliance**

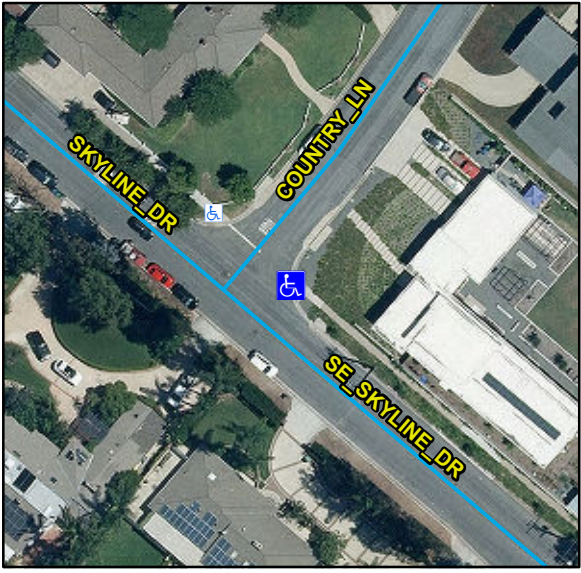

Possible Solutions:
Remove & Replace Entire Ramp. Remove & Replace Gutter.

Surveyor Notes:
N/A

OC Std/PROW:
R304.5.2, R305, R304.5.4, STD 1115

Total Cost: \$ 3332

Parcel ID Number: 502-291-01
Ramp Island Or Median: None
Ramp Orientation: NonDiag
Google Street View Link:
http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.7523108,-117.7947287

Street 1 Name: COUNTRY_LN
Stop Condition-Street 1: StopSign
Street 2 Name: SE_SKYLINE_DR
Stop Condition-Street 2: N/A

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	128	Yes	Flare Type LT	
Yes	Ramp Width (in)	97			Curbed2
Yes	Ramp Run Slope (%)	6.4	N/A	Flare Slope LT (%)	N/A
Yes	Ramp Cross Slope (%)	0.2	N/A	Flare Traversable LT	N/A
No	Grade Break	No	N/A	Flare Type RT	
N/A	Grade Break Slope (%)	N/A			Sloped
N/A	Grade Break Cross Slope (%)	N/A	N/A	Flare Slope RT (%)	7.2
	Addl Para Ramp Left?	No	N/A	Flare Traversable RT	No
	Addl Para Ramp Right?	No	No	DWS Provided	No
N/A	Landing Present	Yes	N/A	DWS Contrast	N/A
Yes	Landing Length (in)	110	N/A	DWS Length (in)	N/A
Yes	Landing Width (in)	48	N/A	DWS Full Width	N/A
Yes	Landing Run Slope (%)	0.5		DWS Offset Type	N/A
Yes	Landing Cross Slope (%)	0.9	N/A	DWS Left Offset (in)	N/A
N/A	Landing Movement Obstructed?	No	N/A	DWS Right Offset (in)	N/A
	Landing Movement Type	N/A			
N/A	Landing Shared	No			
N/A	Marked Crosswalk 1	No	N/A	Clear Space	N/A
	Crossing 1 Direction	NW	N/A	Clear Space To Crosswalk (in)	N/A
	Marked Crosswalk 1 Width (in)	N/A			
N/A	Ramp Inside Crosswalk 1	N/A			
	Crossing 1 Slope (%)	1.2			
	Crossing 1 Cross Slope (%)	1.6			
Yes	Gutter Ponding	No	Yes	Curb Slope	5.4
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
No	Gutter Run Slope (%)	6.2		Road Cross Slope (%)	N/A
Yes	Gutter Cross Slope (%)	1.4		Parallel Ramp Side	Right
Yes	Overall Surface Condition	Acceptable	Yes	Perp Joint Present	Yes
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

