




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: MARCY_RANCH_RD	Cross Street: MARCY_DR	Location: NW
-----------------------------	------------------------	--------------

ADA ID: RPRK211012174022	Ramp Type: Type 1 - Perpendicular Diagonal Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 2
--------------------------	--	------------------------	-------------------

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

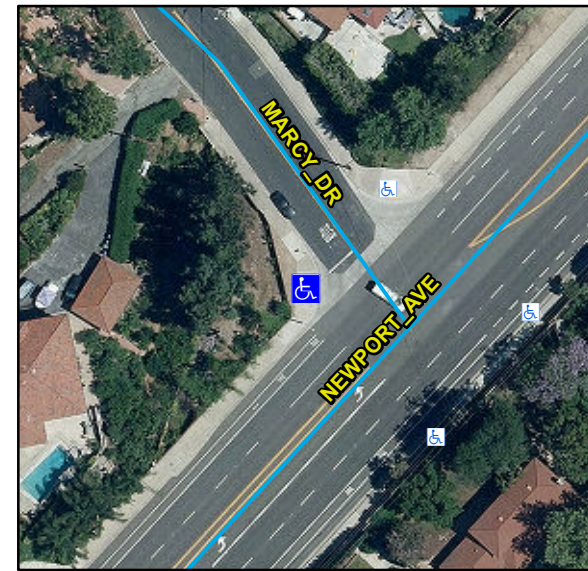

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R204.3, R304.5.3, STD 1115


Total Cost: \$ 6160

Parcel ID Number	393-201-81	Street 1 Name	MARCY_RANCH_RD
Ramp Island Or Median	None	Stop Condition-Street 1	NoControl
Ramp Orientation	Diag	Street 2 Name	MARCY_DR
Google Street View Link:		Stop Condition-Street 2	StopSign

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.7715465,-117.79109562

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

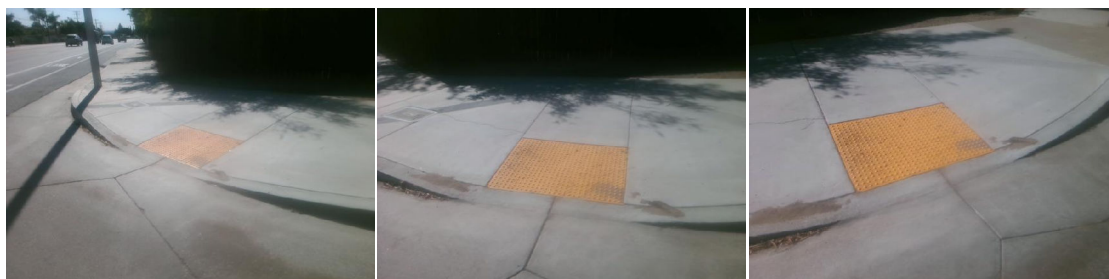

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	102	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			N/A
Yes	Ramp Run Slope (%)	6.4	N/A	Flare Slope LT (%)	N/A
No	Ramp Cross Slope (%)	4.2	N/A	Flare Traversable LT	N/A
N/A	Landing Present	N/A	N/A	Flare Type RT	
N/A	Landing Length (in)	N/A			N/A
N/A	Landing Width (in)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	Flare Traversable RT	N/A
N/A	Landing Cross Slope (%)	N/A	N/A	DWS Provided	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Contrast	N/A
	Landing Movement Type	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Shared	N/A	N/A	DWS Full Width	N/A
N/A	Clear Space	Yes	N/A	DWS Offset Left (in)	N/A
N/A	Clear Space To Crosswalk (in)	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	S		Crossing 2 Direction	NE
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	2.1		Crossing 2 Slope (%)	6.2
	Crossing 1 Cross Slope (%)	1.9		Crossing 2 Cross Slope (%)	3.2
N/A	Gutter Ponding	N/A	No	Curb Slope	9.5
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	0.6
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	5
N/A	Gutter Cross Slope (%)	N/A			
Yes	Overall Surface Condition: Acceptable		No	Perp Joint Present	No
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No