




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: HYDE_PARK_DR **Cross Street:** WICKFORD_DR **Location:** NE

ADA ID: RPRK211013111954 **Ramp Type:** Type 4 - Parallel **Initial Pass/Fail:** Fail **Overall Compliance:** No **Severity Score:** 30

Codes/Mitigation Info/Possible Solution **Field Measurements/Component Compliance**

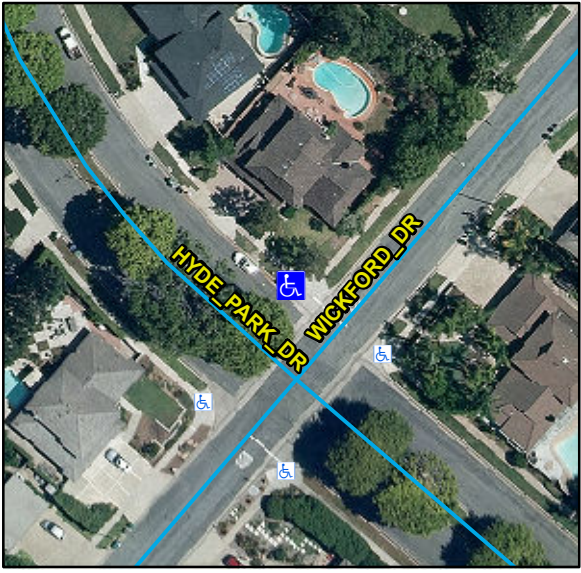

Possible Solutions:
Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:
 N/A

OC Std/PROW:
 R304.5.3, R304.3.2, STD 1115

Total Cost: \$ 4000

Parcel ID Number: 503-521-06
Ramp Island Or Median: None
Ramp Orientation: Diag
Google Street View Link:
http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.76894,-117.78731731

Street 1 Name: HYDE_PARK_DR
Stop Condition-Street 1: NoControl
Street 2 Name: WICKFORD_DR
Stop Condition-Street 2: StopSign

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	126	N/A	Ramp Length RT (in)	122
Yes	Ramp Width LT (in)	118	Yes	Ramp Width RT (in)	121
Yes	Ramp Run Slope LT (%)	5.7	No	Ramp Run Slope RT (%)	8.6
No	Ramp Cross Slope LT (%)	6.8	No	Ramp Cross Slope RT (%)	5.6
N/A	Landing Present	N/A	N/A	DWS Provided	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Contrast	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	DWS Full Width	N/A
N/A	Landing Cross Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Offset Left (in)	N/A
	Landing Movement Type	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Landing Shared	N/A			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	N/A			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	SW		Crossing 2 Direction	SE
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	4.3		Crossing 2 Slope (%)	4
	Crossing 1 Cross Slope (%)	4.6		Crossing 2 Cross Slope (%)	3.3
N/A	Gutter Ponding	N/A	N/A	Curb Slope	1.9
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	2.2
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	8.9
N/A	Gutter Cross Slope (%)	N/A	Yes	Perpendicular Joint Present	Yes
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

