




# Access Compliance Report Public Rights-of-Way (Curb Ramps)



**Main Street:** HYDE\_PARK\_DR      **Cross Street:** WICKFORD\_DR      **Location:** SW

**ADA ID:** RPRK211013112626      **Ramp Type:** Type 1 - Perpendicular Diagonal Initial Pass/Fail: Fail      **Overall Compliance:** No      **Severity Score:** 2

**Codes/Mitigation Info/Possible Solution**      **Field Measurements/Component Compliance**

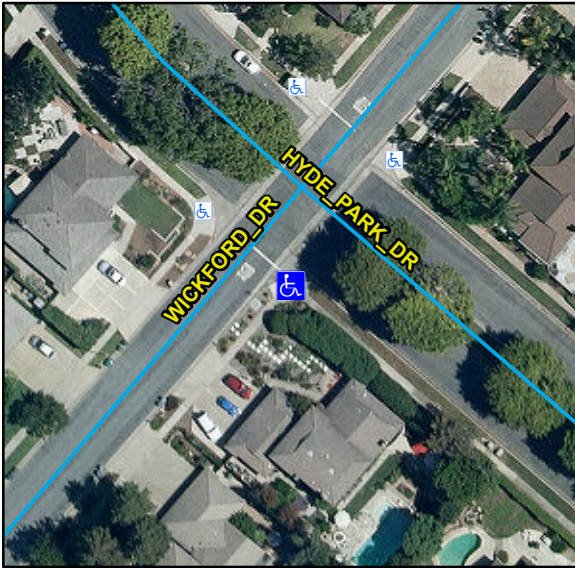

**Possible Solutions:**  
**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

**Surveyor Notes:**  
 N/A

**OC Std/PROW:**  
 R304.2.2, R304.5.3, STD 1115

**Total Cost:** \$ 6160

**Parcel ID Number:** 503-525-01  
**Ramp Island Or Median:** None  
**Ramp Orientation:** Diag  
**Google Street View Link:**  
[http://www.google.com/maps/@?api=1&map\\_action=pano&viewpoint=33.76865605,-117.78732197](http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.76865605,-117.78732197)

**Street 1 Name:** HYDE\_PARK\_DR  
**Stop Condition-Street 1:** NoControl  
**Street 2 Name:** WICKFORD\_DR  
**Stop Condition-Street 2:** StopSign

**Obstruction and Utility Measurement/Component Compliance**

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	121	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			N/A
Yes	Ramp Run Slope (%)	7.6	N/A	Flare Slope LT (%)	N/A
No	Ramp Cross Slope (%)	3.7	N/A	Flare Traversable LT	N/A
N/A	Landing Present	N/A	N/A	Flare Type RT	
N/A	Landing Length (in)	N/A			N/A
N/A	Landing Width (in)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	Flare Traversable RT	N/A
N/A	Landing Cross Slope (%)	N/A	N/A	DWS Provided	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Contrast	N/A
	Landing Movement Type	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Shared	N/A	N/A	DWS Full Width	N/A
N/A	Clear Space	Yes	N/A	DWS Offset Left (in)	N/A
N/A	Clear Space To Crosswalk (in)	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	NE		Crossing 2 Direction	NW
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	5		Crossing 2 Slope (%)	3.5
	Crossing 1 Cross Slope (%)	6.6		Crossing 2 Cross Slope (%)	4.2
N/A	Gutter Ponding	N/A	No	Curb Slope	7.9
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	2.3
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	5.8
N/A	Gutter Cross Slope (%)	N/A			
Yes	Overall Surface Condition: <b>Acceptable</b>		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

