




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: CORONEL_RD		Cross Street: CHERRY_HILL_DR		Location:	NW
ADA ID: RPRK211013121711	Ramp Type: Type 4 - Parallel	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score:	35

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
---	--	---	--

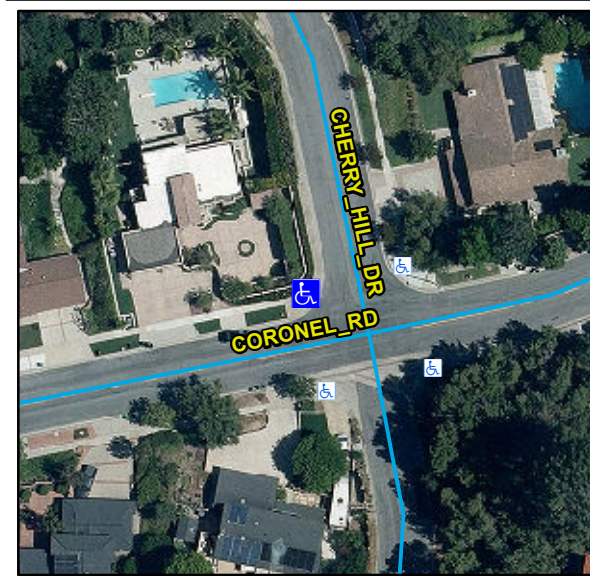

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R204.3, R304.5.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R305, STD 1115

Total Cost: \$ 4252

Parcel ID Number	503-071-09	Street 1 Name	CORONEL_RD
Ramp Island Or Median	None	Stop Condition-Street 1	NoControl
Ramp Orientation	Diag	Street 2 Name	CHERRY_HILL_DR
Google Street View Link:		Stop Condition-Street 2	NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.76725461,-117.78223767

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A



Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	121	N/A	Ramp Length RT (in)	132
Yes	Ramp Width LT (in)	115	Yes	Ramp Width RT (in)	90
Yes	Ramp Run Slope LT (%)	1.5	Yes	Ramp Run Slope RT (%)	4.4
No	Ramp Cross Slope LT (%)	5.2	No	Ramp Cross Slope RT (%)	2.9
N/A	Landing Present	No	No	DWS Provided	No
N/A	Landing Length (in)	N/A	N/A	DWS Contrast	N/A
No	Landing Width (in)	N/A	N/A	DWS Length (in)	N/A
No	Landing Run Slope (%)	N/A	N/A	DWS Full Width	N/A
No	Landing Cross Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Movement Obstructed?	No	N/A	DWS Offset Left (in)	N/A
	Landing Movement Type	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Landing Shared	N/A			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	S		Crossing 2 Direction	E
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	6		Crossing 2 Slope (%)	5.6
	Crossing 1 Cross Slope (%)	9.1		Crossing 2 Cross Slope (%)	2.3
Yes	Gutter Ponding	No	Yes	Curb Slope	1.2
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	5.9
Yes	Gutter Run Slope (%)	1.6		Road Cross Slope (%)	7.2
No	Gutter Cross Slope (%)	6.7	No	Perpendicular Joint Present	No
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A