



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: ST_VINCENT_PL Cross Street: BIMINI_DR Location: W

ADA ID: RPRK211013145234 Ramp Type: Type 6 - Directional 1 Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 10

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

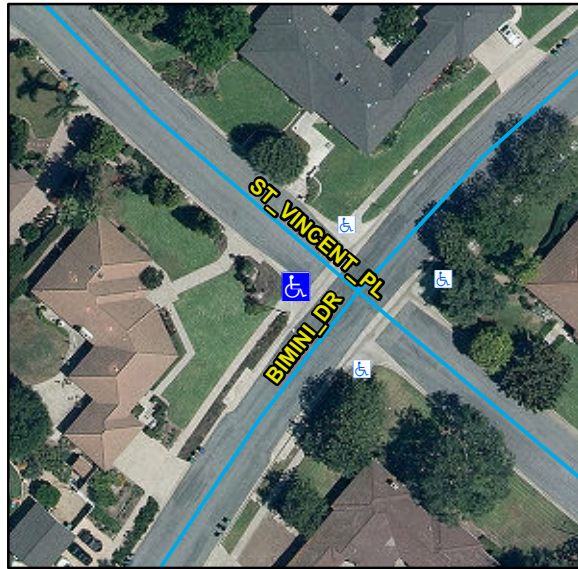

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2-Perp, R304.3.2-Para, R305, STD 1115

Total Cost: \$ 3080

Parcel ID Number **502-261-13**
Ramp Island Or Median **None**
Ramp Orientation **NonDiag**
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.76738334,-117.79139156

Street 1 Name **ST_VINCENT_PL**
Stop Condition-Street 1 **NoControl**
Street 2 Name **BIMINI_DR**
Stop Condition-Street 2 **N/A**

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	128	N/A	Flare Type LT	
Yes	Ramp Width (in)	88			Sloped
Yes	Ramp Run Slope (%)	1.8	N/A	Flare Slope LT (%)	6.5
Yes	Ramp Cross Slope (%)	1.4	N/A	Flare Traversable LT	No
Yes	Grade Break	Yes	Yes	Flare Type RT	
Yes	Grade Break Slope (%)	2			Curbed2
Yes	Grade Break Cross Slope (%)	2.5	N/A	Flare Slope RT (%)	N/A
	Addl Para Ramp Left?	No	N/A	Flare Traversable RT	N/A
	Addl Para Ramp Right?	No	No	DWS Provided	No
N/A	Landing Present	Yes	N/A	DWS Contrast	N/A
Yes	Landing Length (in)	53	N/A	DWS Length (in)	N/A
Yes	Landing Width (in)	48	N/A	DWS Full Width	N/A
No	Landing Run Slope (%)	2.2		DWS Offset Type	N/A
Yes	Landing Cross Slope (%)	2.5	N/A	DWS Left Offset (in)	N/A
N/A	Landing Movement Obstructed?	No	N/A	DWS Right Offset (in)	N/A
	Landing Movement Type	N/A			
N/A	Landing Shared	No			
N/A	Marked Crosswalk 1	No	N/A	Clear Space	N/A
	Crossing 1 Direction	NE	N/A	Clear Space To Crosswalk (in)	N/A
	Marked Crosswalk 1 Width (in)	N/A			
N/A	Ramp Inside Crosswalk 1	N/A			
	Crossing 1 Slope (%)	1.2			
	Crossing 1 Cross Slope (%)	3.5			
Yes	Gutter Ponding	No	Yes	Curb Slope	3.8
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
Yes	Gutter Run Slope (%)	1.7		Road Cross Slope (%)	N/A
Yes	Gutter Cross Slope (%)	2.2		Parallel Ramp Side	Right
Yes	Overall Surface Condition	Acceptable	Yes	Perp Joint Present	Yes
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

