



Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: ORANGE_KNOLL_DR		Cross Street: GATEWAY_DR		Location:	E
ADA ID: RPRK211013171257	Ramp Type: Type 4 - Parallel	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score:	2
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		



Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

OC Std/PROW:

R304.5.3, R304.2.2-Perp, R304.3.2-Para, STD 1115


Total Cost: \$ 4000

Parcel ID Number	393-212-33	Street 1 Name	ORANGE_KNOLL_DR
Ramp Island Or Median	None	Stop Condition-Street 1	NoControl
Ramp Orientation	Diag	Street 2 Name	GATEWAY_DR
Google Street View Link:		Stop Condition-Street 2	NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.7691936,-117.79557317

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

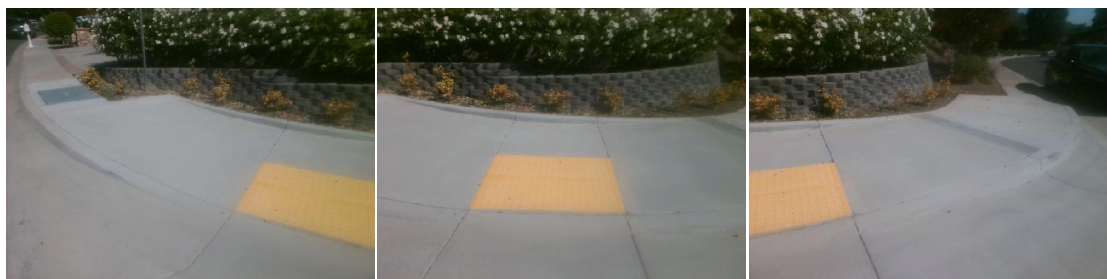

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	110	N/A	Ramp Length RT (in)	80
Yes	Ramp Width LT (in)	85	Yes	Ramp Width RT (in)	85
Yes	Ramp Run Slope LT (%)	5.1	Yes	Ramp Run Slope RT (%)	0.8
No	Ramp Cross Slope LT (%)	2.4	Yes	Ramp Cross Slope RT (%)	1.7
N/A	Landing Present	Yes	Yes	DWS Provided	Yes
N/A	Landing Length (in)	85	Yes	DWS Contrast	Yes
Yes	Landing Width (in)	48	Yes	DWS Length (in)	36
No	Landing Run Slope (%)	2.4	Yes	DWS Full Width	Yes
Yes	Landing Cross Slope (%)	3.5		DWS Offset Type	Single
N/A	Landing Movement Obstructed?	No	Yes	DWS Offset Left (in)	0
	Landing Movement Type	Curb	Yes	DWS Offset Right (in)	N/A
N/A	Landing Shared	No			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	NW		Crossing 2 Direction	SW
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	3.2		Crossing 2 Slope (%)	1.6
	Crossing 1 Cross Slope (%)	8.3		Crossing 2 Cross Slope (%)	3.4
Yes	Gutter Ponding	No	N/A	Curb Slope	3.9
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	5.2
Yes	Gutter Run Slope (%)	2.8		Road Cross Slope (%)	3.9
Yes	Gutter Cross Slope (%)	3.5	Yes	Perpendicular Joint Present	Yes
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No