



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: SADDLERY_RD Cross Street: LEMON_HEIGHTS_DR Location: E

ADA ID: RPRK211014110353 Ramp Type: Type 6 - Directional 1 Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 35

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

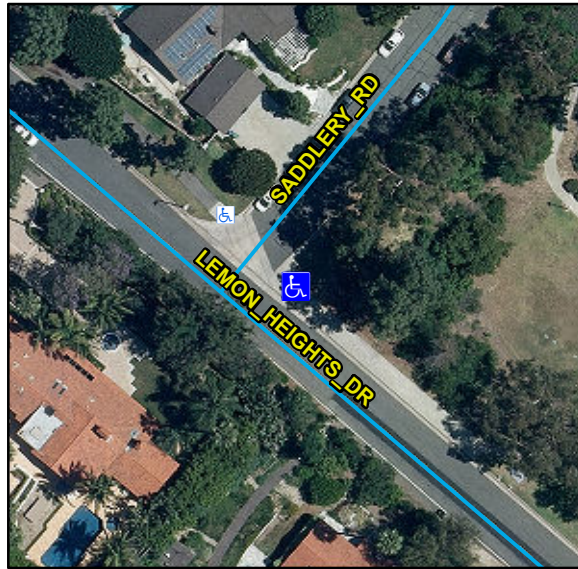

Possible Solutions:

Remove & Replace Entire Ramp. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.5.3, R304.2.2-Perp, R304.3.2-Para, R304.5.2, R305, R304.5.4, STD 1115

Total Cost: \$ 3332

Parcel ID Number 503-463-12
Ramp Island Or Median None
Ramp Orientation NonDiag
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.76413978,-117.77778463

Street 1 Name SADDLERY_RD
Stop Condition-Street 1 NoControl
Street 2 Name LEMON_HEIGHTS_DR
Stop Condition-Street 2 N/A

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	90	Yes	Flare Type LT	
Yes	Ramp Width (in)	70			Curbed2
Yes	Ramp Run Slope (%)	1.9	N/A	Flare Slope LT (%)	N/A
No	Ramp Cross Slope (%)	5.8	N/A	Flare Traversable LT	N/A
No	Grade Break	No	N/A	Flare Type RT	
N/A	Grade Break Slope (%)	N/A			Sloped
N/A	Grade Break Cross Slope (%)	N/A	Yes	Flare Slope RT (%)	0.6
	Addl Para Ramp Left?	No	N/A	Flare Traversable RT	Yes
	Addl Para Ramp Right?	No	No	DWS Provided	No
N/A	Landing Present	Yes	N/A	DWS Contrast	N/A
Yes	Landing Length (in)	136	N/A	DWS Length (in)	N/A
Yes	Landing Width (in)	108	N/A	DWS Full Width	N/A
No	Landing Run Slope (%)	10		DWS Offset Type	N/A
Yes	Landing Cross Slope (%)	2.7	N/A	DWS Left Offset (in)	N/A
N/A	Landing Movement Obstructed?	No	N/A	DWS Right Offset (in)	N/A
	Landing Movement Type	N/A			
N/A	Landing Shared	No			
N/A	Marked Crosswalk 1	No	N/A	Clear Space	N/A
	Crossing 1 Direction	NW	N/A	Clear Space To Crosswalk (in)	N/A
N/A	Marked Crosswalk 1 Width (in)	N/A			
N/A	Ramp Inside Crosswalk 1	N/A			
	Crossing 1 Slope (%)	5.1			
	Crossing 1 Cross Slope (%)	7.4			
Yes	Gutter Ponding	No	N/A	Curb Slope	6.7
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
No	Gutter Run Slope (%)	14.6		Road Cross Slope (%)	N/A
No	Gutter Cross Slope (%)	9.8		Parallel Ramp Side	Left
Yes	Overall Surface Condition	Acceptable	Yes	Perp Joint Present	Yes
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

