



Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: OMEGA_DR		Cross Street: BROWNING_AVE		Location:	E
ADA ID: RPRK211014115635	Ramp Type: Type 7 - Directional 2	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score:	2
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		



Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

OC Std/PROW:

R304.5.3, STD 1115

Total Cost: \$ 3080


Parcel ID Number **104-551-01**
Ramp Island Or Median **None**
Ramp Orientation **NonDiag**
Google Street View Link:

Street 1 Name **OMEGA_DR**
Stop Condition-Street 1 **StopSign**
Street 2 Name **BROWNING_AVE**
Stop Condition-Street 2 **N/A**

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.75022567,-117.78735106

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	N/A
	Obstruction Dimensions	N/A			N/A

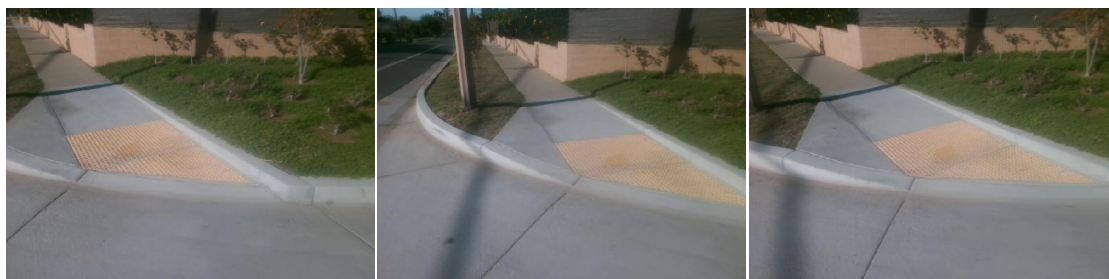

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	162	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			N/A
Yes	Ramp Run Slope (%)	1	N/A	Flare Slope LT (%)	N/A
No	Ramp Cross Slope (%)	2.8	N/A	Flare Traversable LT	N/A
N/A	Grade Break	Yes	N/A	Flare Type RT	
N/A	Grade Break Slope (%)	1			N/A
N/A	Grade Break Cross Slope (%)	2.8	N/A	Flare Slope RT (%)	N/A
	Addl Para Ramp Left?	No	N/A	Flare Traversable RT	N/A
	Addl Para Ramp Right?	No	N/A	DWS Provided	N/A
N/A	Landing Present	N/A	N/A	DWS Contrast	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Full Width	N/A
N/A	Landing Run Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Cross Slope (%)	N/A	N/A	DWS Left Offset (in)	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Right Offset (in)	N/A
	Landing Movement Type	N/A			
N/A	Landing Shared	N/A			
N/A	Marked Crosswalk 1	No	N/A	Clear Space	N/A
	Crossing 1 Direction	SW	N/A	Clear Space To Crosswalk (in)	N/A
	Marked Crosswalk 1 Width (in)	N/A			
N/A	Ramp Inside Crosswalk 1	N/A			
	Crossing 1 Slope (%)	6.5			
	Crossing 1 Cross Slope (%)	4.7			
N/A	Gutter Ponding	N/A	N/A	Curb Slope	13.2
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	N/A
N/A	Gutter Cross Slope (%)	N/A		Parallel Ramp Side	Right
Yes	Overall Surface Condition	Acceptable	Yes	Perp Joint Present	Yes
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No