



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: LA_COLINA_DR Cross Street: BROWNING_AVE Location: SW

ADA ID: RPRK211014134314 Ramp Type: Type 4 - Parallel Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 0

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

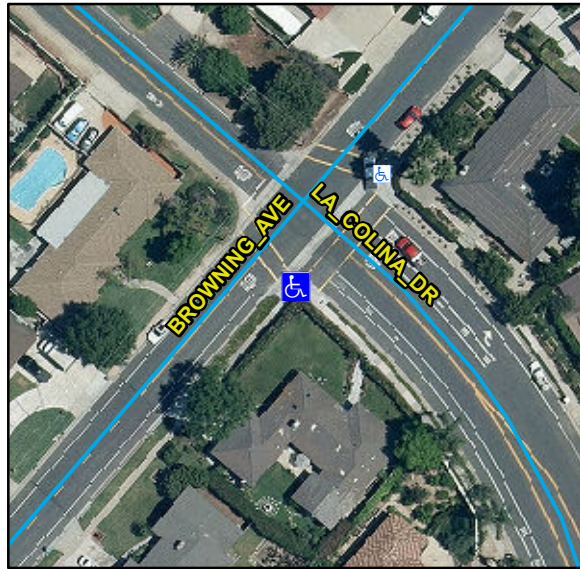

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R304.5.3, STD 1115

Total Cost: \$ 4252

Parcel ID Number 104-331-06
Ramp Island Or Median None
Ramp Orientation Diag
Google Street View Link:

Street 1 Name LA_COLINA_DR
Stop Condition-Street 1 StopSign
Street 2 Name BROWNING_AVE
Stop Condition-Street 2 StopSign

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.74549654,-117.79206315

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	141	N/A	Ramp Length RT (in)	115
Yes	Ramp Width LT (in)	62	Yes	Ramp Width RT (in)	77
Yes	Ramp Run Slope LT (%)	7.9	Yes	Ramp Run Slope RT (%)	7.3
Yes	Ramp Cross Slope LT (%)	1.6	Yes	Ramp Cross Slope RT (%)	0.3
N/A	Landing Present	Yes	Yes	DWS Provided	Yes
N/A	Landing Length (in)	77	Yes	DWS Contrast	Yes
Yes	Landing Width (in)	48	Yes	DWS Length (in)	36
Yes	Landing Run Slope (%)	0.3	Yes	DWS Full Width	Yes
No	Landing Cross Slope (%)	2.4		DWS Offset Type	Single
N/A	Landing Movement Obstructed?	No	Yes	DWS Offset Left (in)	0
	Landing Movement Type	Curb	Yes	DWS Offset Right (in)	N/A
N/A	Landing Shared	No			
Yes	Clear Space	Yes			
Yes	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	Yes
	Crossing 1 Direction	NE		Crossing 2 Direction	NW
	Marked Crosswalk 1 Width (in)	145		Marked Crosswalk 2 Width (in)	144
Yes	Ramp Inside Crosswalk 1	Yes	Yes	Ramp Inside Crosswalk 2	Yes
	Crossing 1 Slope (%)	4.8		Crossing 2 Slope (%)	7.5
	Crossing 1 Cross Slope (%)	2.5		Crossing 2 Cross Slope (%)	2.3
Yes	Gutter Ponding	No	No	Curb Slope	9.6
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	2.8
Yes	Gutter Run Slope (%)	5		Road Cross Slope (%)	7.1
No	Gutter Cross Slope (%)	2.4	Yes	Perpendicular Joint Present	Yes
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

