



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: WINDSOR_LN Cross Street: RED_HILL_AVE Location: S

ADA ID: RPRK211014173251 Ramp Type: Type 6 - Directional 1 Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 6

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

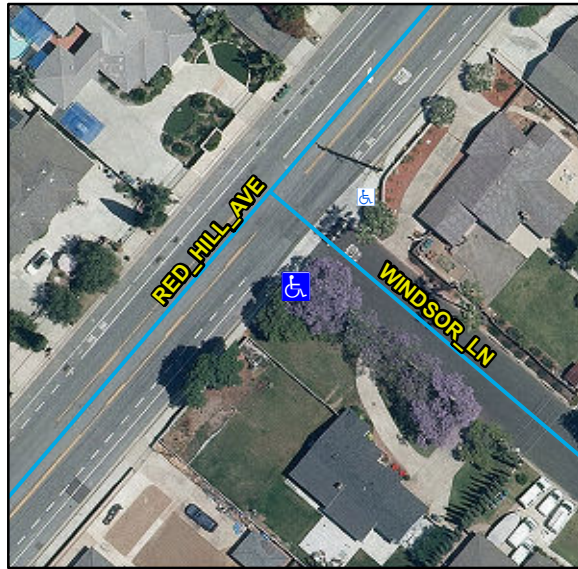

Possible Solutions:

Remove & Replace Entire Ramp. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R304.2.1, R304.5.3, STD 1115

Total Cost: \$ 3332

Parcel ID Number 103-178-13
Ramp Island Or Median None
Ramp Orientation NonDiag
Google Street View Link:

Street 1 Name WINDSOR_LN
Stop Condition-Street 1 StopSign
Street 2 Name RED_HILL_AVE
Stop Condition-Street 2 N/A

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.74903535,-117.79978541

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	144	Yes	Flare Type LT	Curbed2
Yes	Ramp Width (in)	48			
Yes	Ramp Run Slope (%)	4.7	N/A	Flare Slope LT (%)	N/A
Yes	Ramp Cross Slope (%)	2	N/A	Flare Traversable LT	N/A
Yes	Grade Break	Yes	N/A	Flare Type RT	
Yes	Grade Break Slope (%)	1.5			Sloped
Yes	Grade Break Cross Slope (%)	1.4	Yes	Flare Slope RT (%)	5.5
	Addl Para Ramp Left?	No	N/A	Flare Traversable RT	Yes
	Addl Para Ramp Right?	No	Yes	DWS Provided	Yes
N/A	Landing Present	Yes	Yes	DWS Contrast	Yes
No	Landing Length (in)	40	Yes	DWS Length (in)	70
Yes	Landing Width (in)	48	Yes	DWS Full Width	Yes
Yes	Landing Run Slope (%)	1.9		DWS Offset Type	Single
No	Landing Cross Slope (%)	2.8	Yes	DWS Left Offset (in)	0
N/A	Landing Movement Obstructed?	No	N/A	DWS Right Offset (in)	0
	Landing Movement Type	N/A			
N/A	Landing Shared	No			
N/A	Marked Crosswalk 1	No	N/A	Clear Space	N/A
	Crossing 1 Direction	NE	N/A	Clear Space To Crosswalk (in)	N/A
	Marked Crosswalk 1 Width (in)	N/A			
N/A	Ramp Inside Crosswalk 1	N/A			
	Crossing 1 Slope (%)	6.2			
	Crossing 1 Cross Slope (%)	1.4			
Yes	Gutter Ponding	No	No	Curb Slope	10.8
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
Yes	Gutter Run Slope (%)	3.8		Road Cross Slope (%)	N/A
No	Gutter Cross Slope (%)	3		Parallel Ramp Side	Left
Yes	Overall Surface Condition	Acceptable	Yes	Perp Joint Present	Yes
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

