



Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: RED_HILL_AVE		Cross Street: BULLARD_RD		Location:	NW
ADA ID: RPRK211014175456	Ramp Type: Type 4 - Parallel	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score:	2
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		



Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

OC Std/PROW:

R204.3, R304.5.3, STD 1115


Total Cost: \$ 2000

Parcel ID Number	103-721-01	Street 1 Name	RED_HILL_AVE
Ramp Island Or Median	None	Stop Condition-Street 1	Signal
Ramp Orientation	NonDiag	Street 2 Name	BULLARD_RD
Google Street View Link:		Stop Condition-Street 2	N/A

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.7475807,-117.80156752

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	Yes
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A		Pushbutton Post; Street Sign	

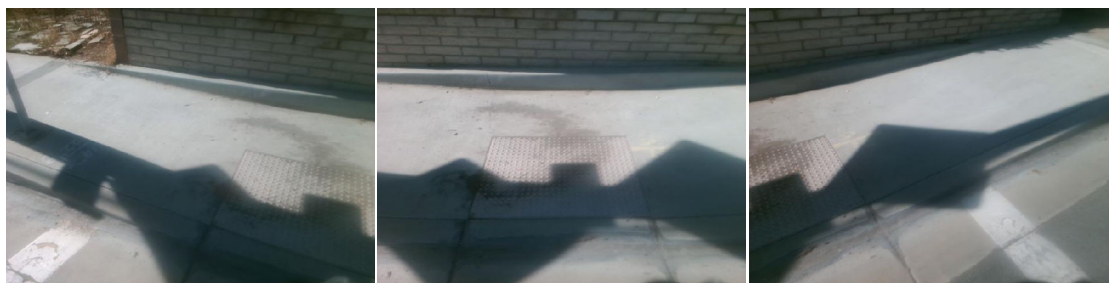

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	111	N/A	Ramp Length RT (in)	168
Yes	Ramp Width LT (in)	70	Yes	Ramp Width RT (in)	70
Yes	Ramp Run Slope LT (%)	5.7	Yes	Ramp Run Slope RT (%)	7.6
No	Ramp Cross Slope LT (%)	2.8	No	Ramp Cross Slope RT (%)	2.4
N/A	Landing Present	N/A	N/A	DWS Provided	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Contrast	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	DWS Full Width	N/A
N/A	Landing Cross Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Offset Left (in)	N/A
	Landing Movement Type	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Landing Shared	N/A			
N/A	Clear Space	N/A			
N/A	Clear Space To Crosswalk (in)	N/A			
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	N/A
	Crossing 1 Direction	SE		Crossing 2 Direction	N/A
	Marked Crosswalk 1 Width (in)	144		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	Yes	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	2.4		Crossing 2 Slope (%)	N/A
	Crossing 1 Cross Slope (%)	5.5		Crossing 2 Cross Slope (%)	N/A
N/A	Gutter Ponding	N/A	N/A	Curb Slope	9.6
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	N/A
N/A	Gutter Cross Slope (%)	N/A	No	Perpendicular Joint Present	No
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A