



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: N/A Cross Street: UNIVERSITY_DR Location: NW

ADA ID: RPRK211018110136 Ramp Type: Type 6 - Directional 1 Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 10

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

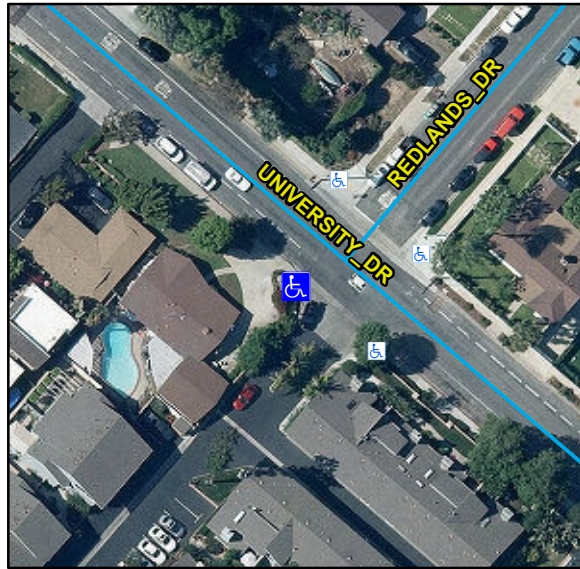

Possible Solutions:

Install Landing.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, STD 1115

Total Cost: \$ 531

Parcel ID Number 439-091-17

Ramp Island Or Median None

Ramp Orientation NonDiag

Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.65729413,-117.88923763

Street 1 Name N/A

Stop Condition-Street 1 StopSign

Street 2 Name UNIVERSITY_DR

Stop Condition-Street 2 N/A

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	182	Yes	Flare Type LT	Curbed2
Yes	Ramp Width (in)	55			
Yes	Ramp Run Slope (%)	5.9	N/A	Flare Slope LT (%)	N/A
Yes	Ramp Cross Slope (%)	1.1	N/A	Flare Traversable LT	N/A
Yes	Grade Break	Yes	N/A	Flare Type RT	
Yes	Grade Break Slope (%)	1.5			Sloped
Yes	Grade Break Cross Slope (%)	1.1	Yes	Flare Slope RT (%)	3.9
	Addl Para Ramp Left?	No	N/A	Flare Traversable RT	Yes
	Addl Para Ramp Right?	No	Yes	DWS Provided	Yes
N/A	Landing Present	No	Yes	DWS Contrast	Yes
No	Landing Length (in)	N/A	Yes	DWS Length (in)	116
No	Landing Width (in)	N/A	Yes	DWS Full Width	Yes
No	Landing Run Slope (%)	N/A		DWS Offset Type	Single
No	Landing Cross Slope (%)	N/A	Yes	DWS Left Offset (in)	0
N/A	Landing Movement Obstructed?	No	N/A	DWS Right Offset (in)	0
	Landing Movement Type	N/A			
N/A	Landing Shared	N/A			
N/A	Marked Crosswalk 1	No	N/A	Clear Space	N/A
	Crossing 1 Direction	SE	N/A	Clear Space To Crosswalk (in)	N/A
N/A	Marked Crosswalk 1 Width (in)	N/A			
N/A	Ramp Inside Crosswalk 1	N/A			
	Crossing 1 Slope (%)	1			
	Crossing 1 Cross Slope (%)	3.2			
Yes	Gutter Ponding	No	Yes	Curb Slope	1.9
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
Yes	Gutter Run Slope (%)	3.2		Road Cross Slope (%)	N/A
Yes	Gutter Cross Slope (%)	1.4		Parallel Ramp Side	Left
Yes	Overall Surface Condition	Acceptable	Yes	Perp Joint Present	Yes
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

