



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: WILLO_LN Cross Street: UNIVERSITY_DR Location: E

ADA ID: RPRK211018111820 Ramp Type: Type 6 - Directional 1 Initial Pass/Fail: Pass Overall Compliance: Yes Severity Score: 0

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

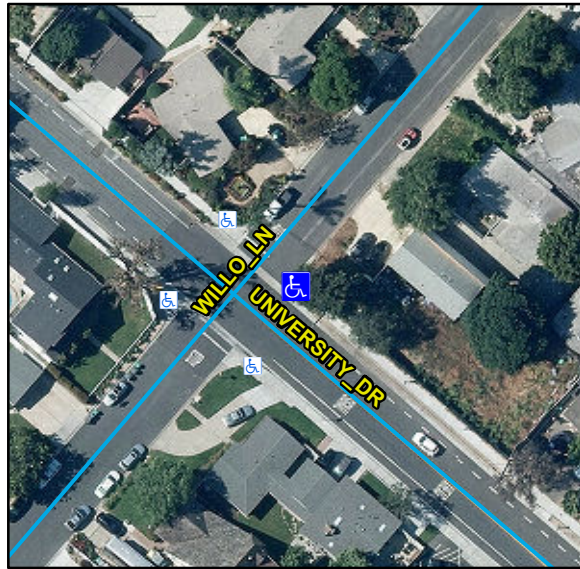

Possible Solutions:

N/A

Surveyor Notes:

N/A

OC Std/PROW:

N/A

Total Cost:

\$ 0

Parcel ID Number 439-112-52

Ramp Island Or Median None

Ramp Orientation NonDiag

Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.65676509,-117.88821274

Street 1 Name WILLO_LN

Stop Condition-Street 1 StopSign

Street 2 Name UNIVERSITY_DR

Stop Condition-Street 2 N/A

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	142	Yes	Flare Type LT	
Yes	Ramp Width (in)	59			Curbed2
Yes	Ramp Run Slope (%)	8.1	N/A	Flare Slope LT (%)	N/A
Yes	Ramp Cross Slope (%)	1.1	N/A	Flare Traversable LT	N/A
Yes	Grade Break	Yes	Yes	Flare Type RT	
Yes	Grade Break Slope (%)	4.7			Curbed2
Yes	Grade Break Cross Slope (%)	1.5	N/A	Flare Slope RT (%)	N/A
	Addl Para Ramp Left?	No	N/A	Flare Traversable RT	N/A
	Addl Para Ramp Right?	No	Yes	DWS Provided	Yes
N/A	Landing Present	Yes	Yes	DWS Contrast	Yes
Yes	Landing Length (in)	50	Yes	DWS Length (in)	74
Yes	Landing Width (in)	58	Yes	DWS Full Width	Yes
Yes	Landing Run Slope (%)	1		DWS Offset Type	Single
Yes	Landing Cross Slope (%)	0.8	Yes	DWS Left Offset (in)	0
N/A	Landing Movement Obstructed?	No	N/A	DWS Right Offset (in)	0
	Landing Movement Type	N/A			
N/A	Landing Shared	No			
N/A	Marked Crosswalk 1	No	N/A	Clear Space	N/A
	Crossing 1 Direction	NW	N/A	Clear Space To Crosswalk (in)	N/A
N/A	Marked Crosswalk 1 Width (in)	N/A			
N/A	Ramp Inside Crosswalk 1	N/A			
	Crossing 1 Slope (%)	7.7			
	Crossing 1 Cross Slope (%)	0.5			
Yes	Gutter Ponding	No	Yes	Curb Slope	0.8
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
Yes	Gutter Run Slope (%)	1.1		Road Cross Slope (%)	N/A
Yes	Gutter Cross Slope (%)	0.4		Parallel Ramp Side	N/A
Yes	Overall Surface Condition	Acceptable	Yes	Perp Joint Present	Yes
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

