



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: WILLO_LN Cross Street: UNIVERSITY_DR Location: S

ADA ID: RPRK211018112219 Ramp Type: Type 6 - Directional 1 Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 10

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

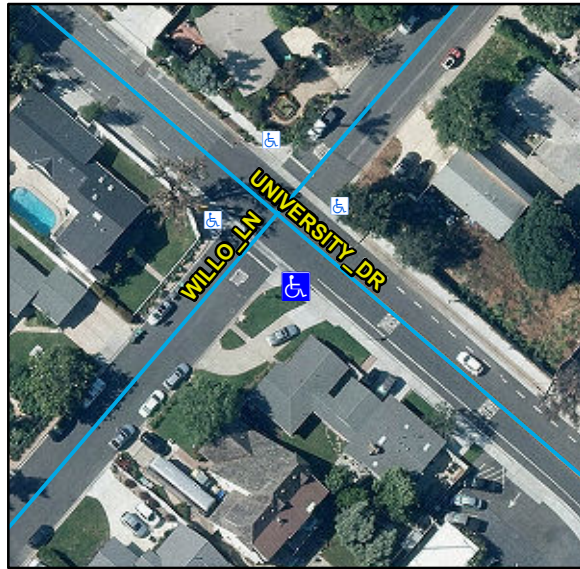

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, STD 1115

Total Cost: \$ 3080

Parcel ID Number 439-111-20
Ramp Island Or Median None
Ramp Orientation NonDiag
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.65664988,-117.88828554

Street 1 Name WILLO_LN
Stop Condition-Street 1 StopSign
Street 2 Name UNIVERSITY_DR
Stop Condition-Street 2 N/A

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	142	Yes	Flare Type LT	
Yes	Ramp Width (in)	59			Curbed2
Yes	Ramp Run Slope (%)	6.8	N/A	Flare Slope LT (%)	N/A
Yes	Ramp Cross Slope (%)	0.9	N/A	Flare Traversable LT	N/A
Yes	Grade Break	Yes	Yes	Flare Type RT	
No	Grade Break Slope (%)	8.3			Curbed2
Yes	Grade Break Cross Slope (%)	0.3	N/A	Flare Slope RT (%)	N/A
	Addl Para Ramp Left?	No	N/A	Flare Traversable RT	N/A
	Addl Para Ramp Right?	No	Yes	DWS Provided	Yes
N/A	Landing Present	No	Yes	DWS Contrast	Yes
No	Landing Length (in)	N/A	Yes	DWS Length (in)	84
No	Landing Width (in)	N/A	Yes	DWS Full Width	Yes
No	Landing Run Slope (%)	N/A		DWS Offset Type	Single
No	Landing Cross Slope (%)	N/A	Yes	DWS Left Offset (in)	0
N/A	Landing Movement Obstructed?	No	N/A	DWS Right Offset (in)	0
	Landing Movement Type	N/A			
N/A	Landing Shared	N/A			
N/A	Marked Crosswalk 1	No	N/A	Clear Space	N/A
	Crossing 1 Direction	NW	N/A	Clear Space To Crosswalk (in)	N/A
	Marked Crosswalk 1 Width (in)	N/A			
N/A	Ramp Inside Crosswalk 1	N/A			
	Crossing 1 Slope (%)	1.8			
	Crossing 1 Cross Slope (%)	0.8			
Yes	Gutter Ponding	No	Yes	Curb Slope	3.2
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
Yes	Gutter Run Slope (%)	1.4		Road Cross Slope (%)	N/A
Yes	Gutter Cross Slope (%)	1.7		Parallel Ramp Side	N/A
Yes	Overall Surface Condition	Acceptable	Yes	Perp Joint Present	Yes
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

