



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: ANNIVERSARY_LN Cross Street: IRVINE_AVE Location: SE

ADA ID: RPRK211018122450 Ramp Type: Type 7 - Directional 2 Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 4

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

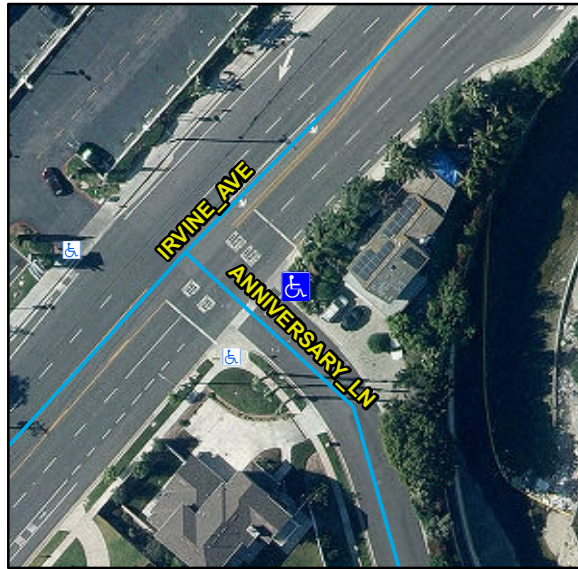

Possible Solutions:

Remove & Replace Entire Ramp. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R204.3, R304.2.1, R304.5.3, R305.2, STD 1115

Total Cost: \$ 3332

Parcel ID Number 119-300-12
Ramp Island Or Median None
Ramp Orientation NonDiag
Google Street View Link:

Street 1 Name ANNIVERSARY_LN
Stop Condition-Street 1 StopSign
Street 2 Name IRVINE_AVE
Stop Condition-Street 2 N/A

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.65799326,-117.8848301

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	152	N/A	Flare Type LT	
Yes	Ramp Width (in)	70			None
Yes	Ramp Run Slope (%)	6.6	N/A	Flare Slope LT (%)	N/A
Yes	Ramp Cross Slope (%)	0.9	N/A	Flare Traversable LT	N/A
Yes	Grade Break	Yes	Yes	Flare Type RT	
Yes	Grade Break Slope (%)	4.6			Curbed2
Yes	Grade Break Cross Slope (%)	1.2	N/A	Flare Slope RT (%)	N/A
	Addl Para Ramp Left?	No	N/A	Flare Traversable RT	N/A
	Addl Para Ramp Right?	No	Yes	DWS Provided	Yes
N/A	Landing Present	Yes	Yes	DWS Contrast	Yes
No	Landing Length (in)	39	Yes	DWS Length (in)	36
Yes	Landing Width (in)	79	Yes	DWS Full Width	Yes
Yes	Landing Run Slope (%)	1.4		DWS Offset Type	Multiple
No	Landing Cross Slope (%)	2.1	Yes	DWS Left Offset (in)	0
N/A	Landing Movement Obstructed?	No	No	DWS Right Offset (in)	70
	Landing Movement Type	N/A			
N/A	Landing Shared	No			
N/A	Marked Crosswalk 1	No	N/A	Clear Space	N/A
	Crossing 1 Direction	SW	N/A	Clear Space To Crosswalk (in)	N/A
	Marked Crosswalk 1 Width (in)	N/A			
N/A	Ramp Inside Crosswalk 1	N/A			
	Crossing 1 Slope (%)	8.4			
	Crossing 1 Cross Slope (%)	4.2			
Yes	Gutter Ponding	No	No	Curb Slope	54
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
Yes	Gutter Run Slope (%)	5		Road Cross Slope (%)	N/A
No	Gutter Cross Slope (%)	5.3		Parallel Ramp Side	Right
Yes	Overall Surface Condition	Acceptable	No	Perp Joint Present	No
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

