



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: MONTE_VISTA_AVE Cross Street: IRVINE_AVE Location: N

ADA ID: RPRK211018124450 Ramp Type: Type 4 - Parallel Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 6

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

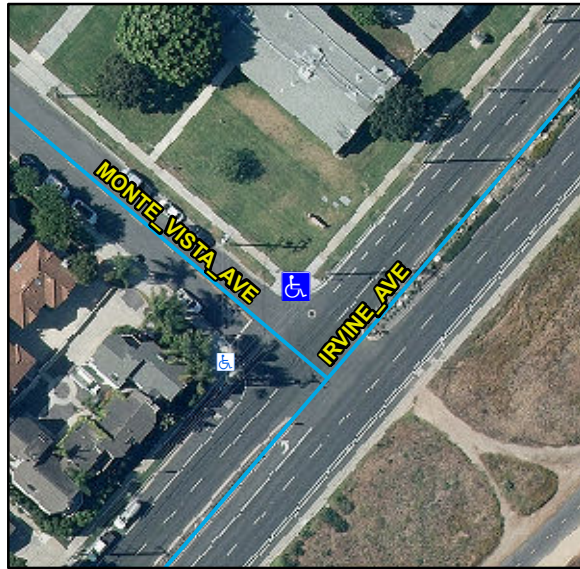

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R204.3, R304.5.4, STD 1115

Total Cost: \$ 4252

Parcel ID Number	439-121-21	Street 1 Name	MONTE_VISTA_AVE
Ramp Island Or Median	None	Stop Condition-Street 1	StopSign
Ramp Orientation	Diag	Street 2 Name	IRVINE_AVE
Google Street View Link:		Stop Condition-Street 2	NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.65319831,-117.88985057

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	135	N/A	Ramp Length RT (in)	133
Yes	Ramp Width LT (in)	113	Yes	Ramp Width RT (in)	115
Yes	Ramp Run Slope LT (%)	7	Yes	Ramp Run Slope RT (%)	8.1
Yes	Ramp Cross Slope LT (%)	2	Yes	Ramp Cross Slope RT (%)	1
N/A	Landing Present	Yes	Yes	DWS Provided	Yes
N/A	Landing Length (in)	60	Yes	DWS Contrast	Yes
Yes	Landing Width (in)	48	Yes	DWS Length (in)	36
Yes	Landing Run Slope (%)	1	Yes	DWS Full Width	Yes
Yes	Landing Cross Slope (%)	0.5		DWS Offset Type	Single
N/A	Landing Movement Obstructed?	No	Yes	DWS Offset Left (in)	0
	Landing Movement Type	Curb	Yes	DWS Offset Right (in)	N/A
N/A	Landing Shared	No			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	SW		Crossing 2 Direction	SE
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	7.3		Crossing 2 Slope (%)	2.4
	Crossing 1 Cross Slope (%)	0.6		Crossing 2 Cross Slope (%)	3.1
Yes	Gutter Ponding	No	No	Curb Slope	14.8
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	1.4
No	Gutter Run Slope (%)	8.4		Road Cross Slope (%)	4.1
Yes	Gutter Cross Slope (%)	0.5	No	Perpendicular Joint Present	No
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

