



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: SHASTA_CT Cross Street: STARLIGHT_RIDGE Location: SW

ADA ID: RPRK211018174231 Ramp Type: Type 1 - Perpendicular Diagonal Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 60

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

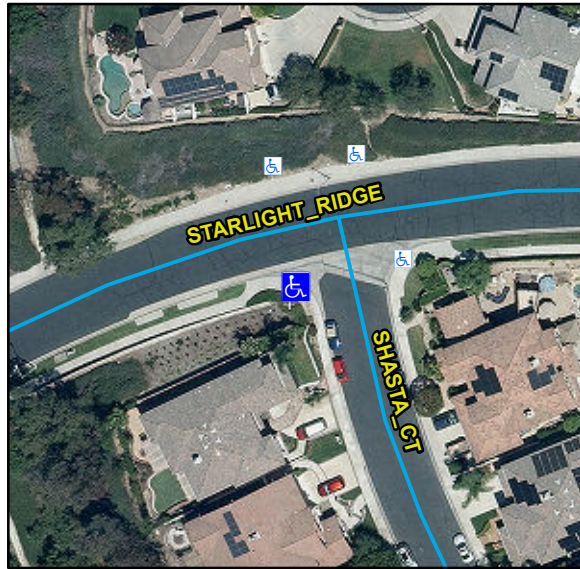

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R304.5.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.2.3, R305, R302.7.2, R304.5.4, STD 1115

Total Cost: \$ 6412

Parcel ID Number	780-111-11	Street 1 Name	SHASTA_CT
Ramp Island Or Median	None	Stop Condition-Street 1	NoControl
Ramp Orientation	Diag	Street 2 Name	STARLIGHT_RIDGE
Google Street View Link:		Stop Condition-Street 2	NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.58862994,-117.62287322

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	84	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			Sloped
Yes	Ramp Run Slope (%)	2.1	No	Flare Slope LT (%)	18.3
No	Ramp Cross Slope (%)	11.8	N/A	Flare Traversable LT	Yes
N/A	Landing Present	No	N/A	Flare Type RT	
N/A	Landing Length (in)	N/A			Sloped
No	Landing Width (in)	N/A	Yes	Flare Slope RT (%)	5.4
No	Landing Run Slope (%)	N/A	N/A	Flare Traversable RT	Yes
No	Landing Cross Slope (%)	N/A	No	DWS Provided	No
N/A	Landing Movement Obstructed?	Yes	N/A	DWS Contrast	N/A
	Landing Movement Type	Curb	N/A	DWS Length (in)	N/A
N/A	Landing Shared	N/A	N/A	DWS Full Width	N/A
N/A	Clear Space	Yes	N/A	DWS Offset Left (in)	N/A
N/A	Clear Space To Crosswalk (in)	48	N/A	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	E		Crossing 2 Direction	N
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	6.7		Crossing 2 Slope (%)	4.7
	Crossing 1 Cross Slope (%)	4.7		Crossing 2 Cross Slope (%)	9.7
Yes	Gutter Ponding	No	No	Curb Slope	8
No	Gutter Lip Height (in)	0.25		Road Run Slope (%)	8.9
No	Gutter Run Slope (%)	5.1		Road Cross Slope (%)	3.5
No	Gutter Cross Slope (%)	9.7			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

