




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: OAKTREE		Cross Street: ANTONIO_PKWY		Location:	SW
ADA ID: RPRK211019114044	Ramp Type: Type 4 - Parallel	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score:	30

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
---	--	--	---	--	--

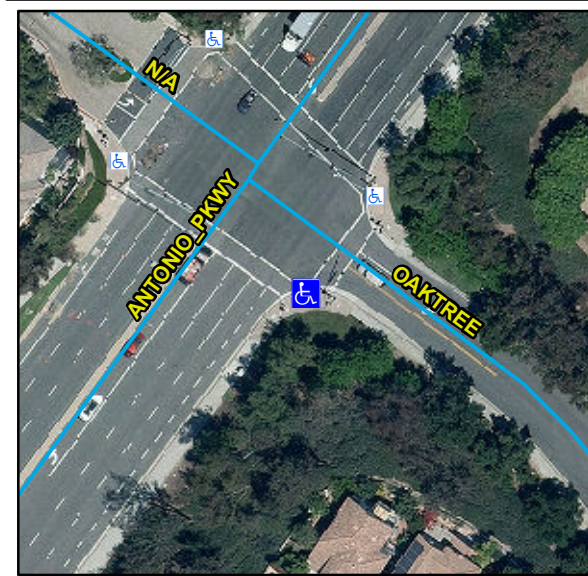

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Grind Gutter Lip.

Surveyor Notes:

N/A

OC Std/PROW:

R204.3, R304.5.3, R302.7.2, STD 1115

Total Cost: \$ 4150

Parcel ID Number	780-171-55	Street 1 Name	OAKTREE
Ramp Island Or Median	None	Stop Condition-Street 1	Signal
Ramp Orientation	Diag	Street 2 Name	ANTONIO_PKWY
Google Street View Link:		Stop Condition-Street 2	Signal
http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.59080011,-117.6267846			

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	92	N/A	Ramp Length RT (in)	96
Yes	Ramp Width LT (in)	75	Yes	Ramp Width RT (in)	74
Yes	Ramp Run Slope LT (%)	7.3	Yes	Ramp Run Slope RT (%)	0.3
No	Ramp Cross Slope LT (%)	8.2	No	Ramp Cross Slope RT (%)	9.9
N/A	Landing Present	N/A	N/A	DWS Provided	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Contrast	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	DWS Full Width	N/A
N/A	Landing Cross Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Offset Left (in)	N/A
	Landing Movement Type	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Landing Shared	N/A			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	Yes
	Crossing 1 Direction	NE		Crossing 2 Direction	NW
	Marked Crosswalk 1 Width (in)	144		Marked Crosswalk 2 Width (in)	144
N/A	Ramp Inside Crosswalk 1	Yes	N/A	Ramp Inside Crosswalk 2	Yes
	Crossing 1 Slope (%)	2.7		Crossing 2 Slope (%)	4.2
	Crossing 1 Cross Slope (%)	4.2		Crossing 2 Cross Slope (%)	3.1
N/A	Gutter Ponding	N/A	N/A	Curb Slope	10.7
No	Gutter Lip Height (in)	0.5		Road Run Slope (%)	3.2
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	0.7
N/A	Gutter Cross Slope (%)	N/A	No	Perpendicular Joint Present	No
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

