




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: SPRING_VIEW_WAY	Cross Street: ROLLING_RIDGE	Location: SE
------------------------------	-----------------------------	--------------

ADA ID: RPRK211019140953	Ramp Type: Type 4 - Parallel	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 30
--------------------------	------------------------------	-------------------------	------------------------	--------------------

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

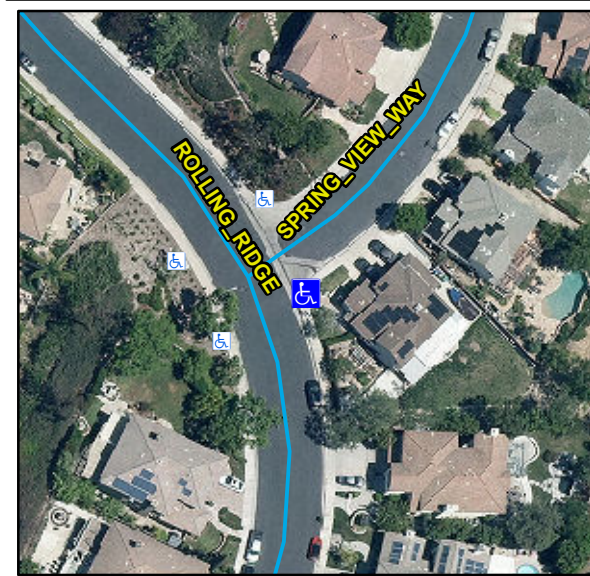

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Grind Gutter Lip.

Surveyor Notes:

N/A

OC Std/PROW:

R204.3, R304.5.3, R302.7.2, STD 1115


Total Cost: \$ 4150

Parcel ID Number	780-192-31	Street 1 Name	SPRING_VIEW_WAY
Ramp Island Or Median	None	Stop Condition-Street 1	NoControl
Ramp Orientation	Diag	Street 2 Name	ROLLING_RIDGE
Google Street View Link:		Stop Condition-Street 2	NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.58407122,-117.62136741

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

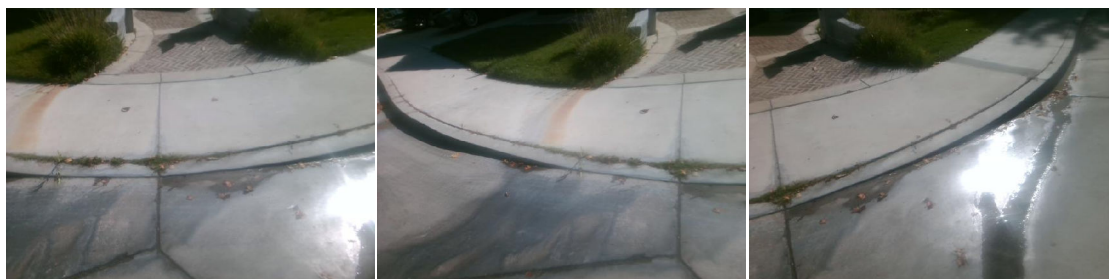

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	117	N/A	Ramp Length RT (in)	117
Yes	Ramp Width LT (in)	53	Yes	Ramp Width RT (in)	54
Yes	Ramp Run Slope LT (%)	1.3	Yes	Ramp Run Slope RT (%)	6.6
No	Ramp Cross Slope LT (%)	8.1	No	Ramp Cross Slope RT (%)	9.3
N/A	Landing Present	N/A	N/A	DWS Provided	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Contrast	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	DWS Full Width	N/A
N/A	Landing Cross Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Offset Left (in)	N/A
	Landing Movement Type	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Landing Shared	N/A			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	N/A			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	N		Crossing 2 Direction	W
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	0.2		Crossing 2 Slope (%)	3.1
	Crossing 1 Cross Slope (%)	1.7		Crossing 2 Cross Slope (%)	4.2
N/A	Gutter Ponding	N/A	N/A	Curb Slope	6
No	Gutter Lip Height (in)	0.25		Road Run Slope (%)	2.9
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	2.4
N/A	Gutter Cross Slope (%)	N/A	No	Perpendicular Joint Present	No
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No