




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: **OSO_PKWY** Cross Street: **MEANDERING_TRAIL** Location: **NW**

ADA ID: **RPRK211019150808** Ramp Type: **Type 1 - Perpendicular Diagonal** Initial Pass/Fail: **Fail** Overall Compliance: **No** Severity Score: **30**

Codes/Mitigation Info/Possible Solution Field Measurements/Component Compliance

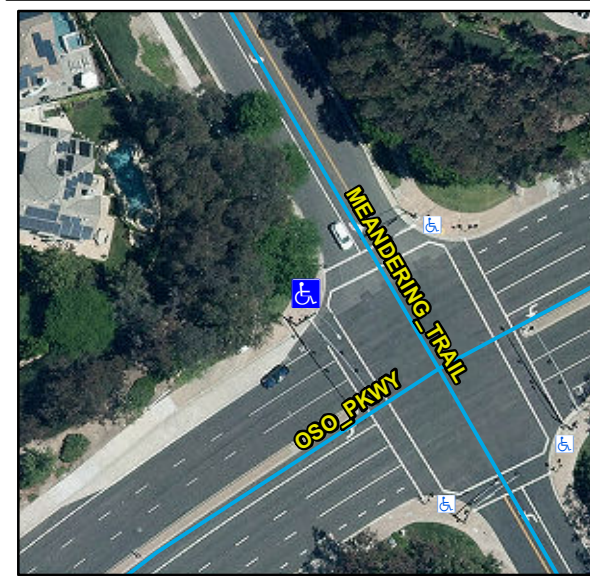

Possible Solutions:
Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:
N/A

OC Std/PROW:
R304.2.2, R204.3, R304.5.3, STD 1115

Total Cost: \$ **6160**

Parcel ID Number **780-131-26**
Ramp Island Or Median **None**
Ramp Orientation **Diag**
Google Street View Link:
http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.58681916,-117.62384957

Street 1 Name **OSO_PKWY**
Stop Condition-Street 1 **Signal**
Street 2 Name **MEANDERING_TRAIL**
Stop Condition-Street 2 **Signal**

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	110	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			N/A
Yes	Ramp Run Slope (%)	5.9	N/A	Flare Slope LT (%)	N/A
No	Ramp Cross Slope (%)	7.5	N/A	Flare Traversable LT	N/A
N/A	Landing Present	N/A	N/A	Flare Type RT	
N/A	Landing Length (in)	N/A			N/A
N/A	Landing Width (in)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	Flare Traversable RT	N/A
N/A	Landing Cross Slope (%)	N/A	N/A	DWS Provided	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Contrast	N/A
	Landing Movement Type	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Shared	N/A	N/A	DWS Full Width	N/A
N/A	Clear Space	Yes	N/A	DWS Offset Left (in)	N/A
N/A	Clear Space To Crosswalk (in)	48	N/A	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	Yes
	Crossing 1 Direction	S		Crossing 2 Direction	E
	Marked Crosswalk 1 Width (in)	144		Marked Crosswalk 2 Width (in)	144
N/A	Ramp Inside Crosswalk 1	Yes	Yes	Ramp Inside Crosswalk 2	Yes
	Crossing 1 Slope (%)	1.7		Crossing 2 Slope (%)	2.9
	Crossing 1 Cross Slope (%)	5.7		Crossing 2 Cross Slope (%)	4.4
N/A	Gutter Ponding	N/A	No	Curb Slope	6.1
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	6.3
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	7.9
N/A	Gutter Cross Slope (%)	N/A			
Yes	Overall Surface Condition: Acceptable		No	Perp Joint Present	No
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

