




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: RADIANCE_LN		Cross Street: DANCING_CLOUD_CT		Location: NW
ADA ID: RPRK211019180433	Ramp Type: Type 4 - Parallel	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 2

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance		
---	--	---	--	--

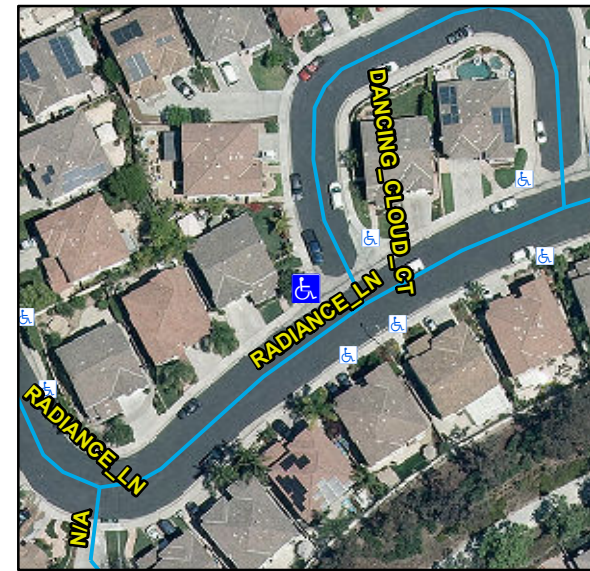

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R204.3, R304.5.3, STD 1115


Total Cost: \$ **4000**

Parcel ID Number	780-202-25	Street 1 Name	RADIANCE_LN
Ramp Island Or Median	None	Stop Condition-Street 1	NoControl
Ramp Orientation	Diag	Street 2 Name	DANCING_CLOUD_CT
Google Street View Link:		Stop Condition-Street 2	NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.58333599,-117.62636031

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

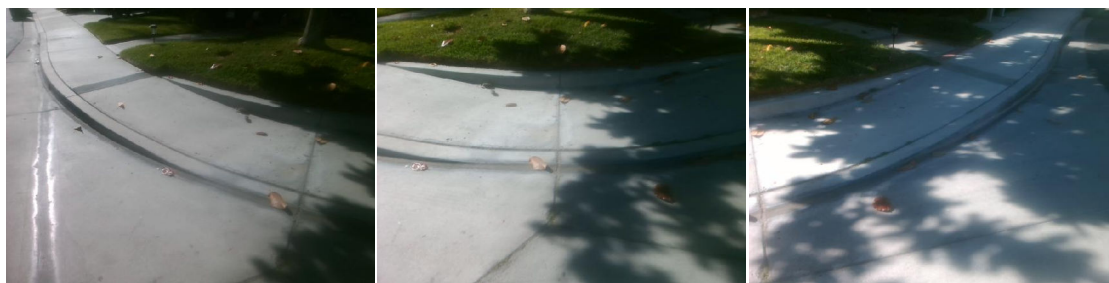

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	118	N/A	Ramp Length RT (in)	117
Yes	Ramp Width LT (in)	48	Yes	Ramp Width RT (in)	48
Yes	Ramp Run Slope LT (%)	2.7	Yes	Ramp Run Slope RT (%)	3.1
Yes	Ramp Cross Slope LT (%)	0.7	No	Ramp Cross Slope RT (%)	2.2
N/A	Landing Present	N/A	N/A	DWS Provided	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Contrast	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	DWS Full Width	N/A
N/A	Landing Cross Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Offset Left (in)	N/A
	Landing Movement Type	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Landing Shared	N/A			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	N/A			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	S		Crossing 2 Direction	E
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	3.6		Crossing 2 Slope (%)	0.5
	Crossing 1 Cross Slope (%)	0.9		Crossing 2 Cross Slope (%)	1.5
N/A	Gutter Ponding	N/A	No	Curb Slope	8.4
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	0.2
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	3.4
N/A	Gutter Cross Slope (%)	N/A	No	Perpendicular Joint Present	No
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No